CYNGOR GWLEDIG LLANELLI

Adeiladau Vauxhall, Vauxhall, Llanelli, SA15 3BD Ffôn: 01554 774103

PWYLLGOR LLES A HAMDDEN

I'w cynnal yn Siambr y Cyngor a thrwy bresenoldeb o bell ar dydd Mawrth, 18 Mawrth, 2025, am 4.45 y.p.

CLERC y CYNGOR

12 Mawrth, 2025.

AGENDA

- 1. Derbyn ymddiheuriadau am absenoldeb.
- 2. Derbyn Datganiadau o Fudd Personol gan Aelodau o ran y materion sydd i'w trafod.
- 3. <u>Cyfleusterau Cymunedol Gwaith Cynnal A Chadw</u> nodi, er gwybodaeth, adroddiad cynnydd y Rheolwr Cyfleusterau ar y gwaith a wnaed.
- 4. <u>Adroddiadau Arolygu Meysydd Chwarae</u> derbyn adroddiadau arolygu meysydd chwarae ar gyfer cyfleusterau chwarae'r cyngor gan Dragon Play and Sports a chytuno ar ymateb y cyngor.
- 5. <u>Deddf Cyrff Cyhoeddus (Mynediad i Gyfarfodydd)</u>, 1960 ystyried eithrio aelodau'r cyhoedd pan ystyrir y materion canlynol oherwydd natur gyfrinachol y busnes a drafodir.
- 6. Derbyn y Cyfriflenni ac ystyried darparu cymorth ariannol oddi wrth Pwyllgor Datblygiad Tir Hamdden Pwll 31 Rhagfyr, 2024.

Aelodau'r Pwyllgor:

Cyng. D. M. Cundy (Cadeirydd y Pwyllgor), A. J. Rogers (Is-Gadeirydd y Pwyllgor).

M. V. Davies (Cadeirydd y Cyngor) T. M. Donoghue, E. M. Evans, J. P. Hart, S. N. Lewis.

A. G. Morgan, J. S. Phillips, W. E. Skinner, A. G. Stephens a O. Williams.

LLANELLI RURAL COUNCIL

Vauxhall Buildings, Vauxhall, Llanelli. SA15 3BD Tel: 01554 774103

RECREATION AND WELFARE COMMITTEE

To be hosted at the Council Chamber and via remote attendance on Tuesday, 18 March, 2025, at 4.45 p.m.

Mark fallatt CLERK to the COUNCIL

12 March, 2025.

AGENDA

- 1. To receive apologies for absence.
- 2. To receive Members' Declarations of Interest in respect of the business to be transacted.
- 3. Community Facilities Maintenance Works to note for information, the Facilities Manager's progress report on work undertaken.
- 4. Playground Inspection Reports to receive the playground inspection reports for the council's play facilities from Dragon Play and Sports and to agree the council's response.
- 5. Public Bodies (Admission to Meetings) Act, 1960 to consider excluding members of the public during consideration of the following matter owing to the confidential nature of the business to be transacted.
- 6. To receive Statement of Account and to consider providing financial assistance to Pwll Recreation Ground Management Committee - 31 December, 2024.

Members of the Committee:

D. M. Cundy (Chairman of Committee), A. J. Rogers (Vice-Chairman of Committee), Cllrs.

M. V. Davies (Chairman of Council) T. M. Donoghue, E. M. Evans, J. P. Hart, S. N. Lewis.

A. G. Morgan, J. S. Phillips, W. E. Skinner, A. G. Stephens and O. Williams.

To the Chairman and Members of the Recreation and Welfare Committee:

Date of meeting: 18 March, 2025

Dear Councillor,

COMMUNITY FACILITIES - MAINTENANCE WORKS

1. PURPOSE OF REPORT

1.1 To provide Members with an information report on work undertaken by the Council's DLO workforce during January and February 2025.

2. WORK ACTIVITIES

(1) <u>Vauxhall Buildings</u>
Litter pick external areas
Maintenance to extractor fans
Refix carpets

(2) Dafen Community Hall

Padlocks to stage storage doors Plasterboard to cover voids in kitchen celling Installed external gas pipe cover Painted toilets

(3) <u>Dafen Changing rooms</u>

Purge water system
Repaired benches
Fitted temp sensor logger

(4) Dafen Park

Litter picked Empty bins Reset MUGA timer

(5) Felinfoel Community Resource Centre

Litter pick
Empty litter bins
Purge water system
Fill voids in plant room
Fit smoke seals to fire doors
Paint changing rooms
Repair faulty shower non-concussive

(6) Felinfoel Recreation Ground

Litter pick Empty bins

(7) Five Roads Recreation Ground and Community Hall

Litter pick
Empty bins
Fitted fire escape sign
Painted concrete fire escape path

Installed padlock to gas box Repaired gas box door Made adjustments to lower fence

(8) <u>Furnace Community Hall</u>

Litter pick

(9) Llanelli District Cemetery

Preparation, backfilling, levelling of graves and cremation plots Inspect and make safe memorials Litter picking, empty litterbins and clear spent wreaths Tend and maintain remembrance gardens Clean roads and paths Transport wheelie bins

(10) MUGA Llwynhendy

Litter pick Monitor/cleared broken glass

(11) Ponthenri Recreation Ground/Community Hall/ Changing Rooms

Litter pick

Purge water system

Fitted door clasp (nursery)

Padlock to external gas box

Fire door signage

(12) Pwll Pavilion and Recreation Ground

Empty litter bins and litter pick
Refit pvc trim external main door
Remove lock from changing room access door
Removed door clasp from café entrance door
Repairs to roundabout

(13) Sandy and Stradey Community Hall

Litter pick Removed damaged chairs

(14) Saron Community Hall and Square

Litter pick

Repair door closer to main hall door

(15) Swiss Valley Community Hall and Shops

Litter pick Investigate water meter Repaired chairs

(16) Swiss Valley Reservoir

Empty bins, litter pick

Cleared litter around site, footpaths, shore areas and pontoon

Continued patrols to check fishing licenses

Prune vegetation

Clean toilets

Swept footpaths

(17) <u>Tir Einon play area and recreation ground</u>

Litter pick

Empty bins

Surface moss removal

(18) Trallwm Community Hall and park

Empty bins, litter pick

Purge water system

Repaired toilet leak

Adjusted door closer

Fitted door smoke seals

(19) Berwick play area

Litter pick

Empty bins

(20) Dan y Banc play area

Litter pick

Empty bins

(21) Pontyates Park

Litter pick

Empty bins

(22) Cynheidre Park

Litter pick

(23) Footpaths

Glyn Ward

Number	Description
36/12	Noddfa Chapel
36/14	Pontyates Park/New Inn
36/35	Heol Hen Five Roads

Hengoed Ward

Number	Description
36/67	Constitution Hill
36/69	Stradey Park/Sandy bridge
57/88	School memorial/Holy Trinity
72/1	middle Constitution Hill

Pemberton Ward

Number	Description
36/109	opposite White Lion
36/130	Parc Gitto/Tir Einon
72/27	Ivy Cottages to Parc y Scarlets

Dafen Ward

Number	Description
36/103	cycle path/Halfway

Bynea Ward	
Number	Description
36/110	Pant Bryn Isaf
36/111	Cae Bryn
36/123	Saron Road
36/124	off Saron Road
36/125	Station Road
36/126	Incline
36/127	Bell Inn
36/128	Sychnant Fach
36/129	Steps
36/140	INA bearings to Loughor bridge

(24) Porterage Services

Fill fuel storage

Consumables, materials

Vehicles to garages for repairs/tyres etc.

Litter waste and fly tipping removal to waste disposal sites

(25) Machinery and vehicles

Daily maintenance, pre use checks, adjustments and minor repairs to vehicles, tools and equipment.

Clean vehicles, wash and disinfect vehicles, trailers and equipment following litter picking and bin emptying.

Arrange servicing and maintenance

(26) General maintenance works to play areas and recreation grounds

Regular litter picking and emptying litter bins.

Sports pitch work included cutting aerating and marking.

Fine turf autumn work including fertiliser treatments and grass cutting

(27) Maintenance works on behalf of Llanelli Town Council

Regular grounds maintenance services including grass cutting, hedge-cutting and sports surface management to:

Nightingale Court / Clos yr Ysgol / Penyfan / Penygaer / Seaside / Parc y Dre / Morfa / Havelock. Also, additional sports pitch cutting, aeration and marking to Penygaer / Seaside / Parc y Dre and fine turf works at Parc y Dre and Havelock. Additional work includes porterage services and playground repairs

3. LONG TERM IMPLICATIONS

3.1 The work programme is organised on a cyclical basis covering the summer and winter periods. In the summer period the majority of the time focusses on ground maintenance activities, whereas in the winter period the focus switches more to buildings' maintenance activities. Cemetery and Porterage activities are performed throughout the year.

The Council has put in place a preventative maintenance budget based on an annual list of priorities and to cater for day to day contingencies. By adopting a preventative approach this supports sustainable development principles. The cyclical annual maintenance programme ensures community assets are kept in good order, extending the life cycle of the assets over many years.

4. SUSTAINABILITY AND WELL-BEING CONSIDERATIONS

4.1 The Council's capital and revenue investment in the community facilities meets the following aims, core values and well-being goals.

Strategic Aim	Core Value	National Well-Being Goal						
×		1	2_	3	4	5	6	7
Community Development	CD7, CD8			✓	✓	✓		✓
Serving the Public	STP1, STP3, STP4, STP5, STP6	√	√		✓	√	√	✓
Acting as a Local Voice	LV1, LV2				✓	√	1	✓
Quality of Life								
(1) Environment	QL1	✓	✓	✓		✓		√
(2) Social Inclusion								
(3) Safe and Healthy	QL5			✓	✓	✓		
Places								
Sports, Leisure and				✓	✓		✓	
Cultural	SLC1							
Activities								
The Local Economy								
Local Democracy								
Partnership Working	PW2, PW6	✓			✓	✓		
Communication								
Health and Safety	HS1, HS4, HS5	✓		✓		✓_		√
Resources	R2, R3	✓	✓	<u> </u>				<u>√</u>
Management and Control	MC2, MC4, MC5, MC6	✓	✓		✓	1	 ✓	

5. PUBLIC INVOLVEMENT

5.1 There are no public involvement opportunities identified in preparing this report. However, the Council will examine public involvement in this area of activity as part of plans to promote volunteering initiatives and opportunities in the wider community.

6. COLLABORATION OPPORTUNITIES

The council works in collaboration with Carmarthenshire County Council on certain tasks such as footpath maintenance. The council works in collaboration with Llanelli Town Council by providing grounds maintenance services and support.

7. PREVENTATIVE MEASURES/CONSIDERATIONS

7.1 The work activities undertaken by the workforce are essential to support the Council's preventative maintenance programme in order to maintain community facilities and assets and to keep them in good safe working order. It is important to carry forward appropriate budget provision to support the Council's area of responsibilities and its general programme of works. This will ensure the Council is contributing to a safe and healthy environment, removing the risk of harm to members of the public when using Council/community facilities.

8. RECOMMENDATION

8.1 That Members note this information report.

Yours sincerely

FACILITIES MANAGER

12 March, 2025



Annual Inspection

Safety Inspection Report

Llanelli Rural Council Clos y Gelli Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with PSSLive⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	
Site Name	Clos Y Gelli Play Area	/ /\
Actual Date	10/02/2025 13:18:32	/ , / \ \
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	
Inspection Status	Completed	
		() ()
		10/02/2025
		10/02/2020



Finding Summary

Close Y Gelli Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Entrance - Gate	Gate - Self-Closing - Adjustment	12/04/2023 15:08:14	Low
Signage - playground	Item - Hard or Sharp Projections	12/04/2023 15:13:32	Low
Rocker - Spring Horse - Surface - Wet Pour	Surface - Edges Shrunk	12/04/2023 15:17:39	Low
Rocker - Spring Dinosaur - Surface - Wet Pour	Surface - Edges Shrunk	12/04/2023 15:19:38	Low
Rocker - Spring Dinosaur	Item - Bolt(s) loose	12/04/2023 15:20:09	Low
Swing - 1Bay Toddler Seat - Surface - Wet Pour	Surface - Cracking	12/04/2023 15:24:33	Low
Swing - 1Bay Toddler Seat	Minimum Space - Seat to Seat	12/04/2023 15:24:59	Low
Swing - 1Bay Toddler Seat	Metal - Paint-work - Not in Good Condition	12/04/2023 15:25:45	Low
Swing - 1Bay Toddler Seat	Chain - Connectors Worn	12/04/2023 15:26:41	Low
Swing - 1Bay Toddler Seat	Item - Damaged	12/04/2023 15:27:06	Low
Multiplay Unit	Barriers - Height Low	12/04/2023 15:29:51	Low
Multiplay Unit	Item - Limited Life	12/04/2023 15:30:22	Low



Inspection - Close Y Gelli Play Area - 10/02/2025 13:18:32

Provider	Provider	
Site Name	Close Y Gelli Play Area	_/ / / / / /
Actual Date	10/02/2025 13:18:32	
Inspection Type	Playground-Annual	$-() \cup \sim \langle \langle \langle \langle \rangle \rangle \rangle$
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	

Site Name	Close Y Gelli Play Area
Address	Close Y Gelli Pemberton
Postcode	SA149BB
Notes	
Site Owner	Llanelli Rural Council

Close Y Gelli Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Clôs Y Gelli Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Carousel
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Carousel - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4

Asset Name	Entrance - Gate	
Asset Type	Entrance	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	



Asset Name	Fencing - Bowtop	i
Asset Type	Fencing	H
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
	- 	-





Litter Bin
Bins
Facilities
Very Low
3



Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	No
Risk Level	Low
Risk Score	6



Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Rocker - Spring Dinosaur
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	HAGS Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Dinosaur - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Horse
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	HAGS Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rocker - Spring Horse - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4





Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	No
Risk Level	Low
Risk Score	5



Swing - 1Bay Toddler Seat - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Entrance - Gate - Finding

Finding Title	Gate - Self-Closing - Adjustment
Asset	Entrance - Gate
Finding Creation Date	12/04/2023 15:08:14
Finding Group	Maintenance
Finding Notes	
Risk Level	Low





Gate - Self-Closing - Adjustment - Task

Task Title	Adjust self-closure mechanism

Multiplay Unit - Findings

Finding Title	Item - Limited Life	What I was a second
Asset	Multiplay Unit	
Finding Creation Date	12/04/2023 15:30:22	
Finding Group	Maintenance	
Finding Notes	Due to timber decay below ground and overall condition of unit - Unit has limited life	
Risk Level	Low	
		Asset Photo



Item - Limited Life - Task

Task Title	Programme replacement

Barriers - Height Low
Multiplay Unit
12/04/2023 15:29:51
BS EN 1176:2017 Part 1 (General - Playground)
Low
LOW
-



Asset Photo

Finding Photos



Barriers - Height Low - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Rocker - Spring Dinosaur - Finding

Finding Title	Item - Bolt(s) loose	
Asset	Rocker - Spring Dinosaur	*
Finding Creation Date	12/04/2023 15:20:09	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	1
		Asset Photo

Item - Bolt(s) loose - Task

Task Title	Tighten loose fixtures & fittings

Rocker - Spring Dinosaur - Surface - Wet Pour - Finding

Finding Title	Surface - Edges Shrunk
Asset	Rocker - Spring Dinosaur - Surface - Wet Pour
Finding Creation Date	12/04/2023 15:19:38
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo





Surface - Edges Shrunk - Task

Task Title	Repair edges

Rocker - Spring Horse - Surface - Wet Pour - Finding

Finding Title	Surface - Edges Shrunk	
Asset	Rocker - Spring Horse - Surface - Wet Pour	78
Finding Creation Date	12/04/2023 15:17:39	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Surface - Edges Shrunk - Task

Task Title	Repair edges



Signage - playground - Finding

Finding Title	Item - Hard or Sharp Projections	COUNTY
Asset	Signage - playground	
Finding Creation Date	12/04/2023 15:13:32	
Finding Group	Maintenance	Constitution of the consti
Finding Notes	Excess bolt threads	
Risk Level	Low	







Item - Hard or Sharp Projections - Task

Task Title	Remove hard, pointed & sharp projections



Swing - 1Bay Toddler Seat - Findings

Finding Title	Item - Damaged	1
Asset	Swing - 1Bay Toddler Seat	
Finding Creation Date	12/04/2023 15:27:06	
Finding Group	Maintenance	4
Finding Notes	Seat damaged	Į.
Risk Level	Low	
		i







Item - Damaged - Task

Task Title	Replace item



Finding Title	Chain - Connectors Worn
Asset	Swing - 1Bay Toddler Seat
Finding Creation Date	12/04/2023 15:26:41
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Chain - Connectors Worn - Task

Task Title	Replace worn parts



Finding Title	Metal - Paint-work - Not in Good Condition
Asset	Swing - 1Bay Toddler Seat
Finding Creation Date	12/04/2023 15:25:45
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo

Finding Photos



Metal - Paint-work - Not in Good Condition - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Finding Title	Minimum Space - Seat to Seat	2000
Asset	Swing - 1Bay Toddler Seat	2000
Finding Creation Date	12/04/2023 15:24:59	
Finding Group	BS EN 1176:2017 Part 2 (Swings - Playground)	
Finding Notes		
Risk Level	Low	1
	·	1



Asset Photo




Minimum Space - Seat to Seat - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Swing - 1Bay Toddler Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Cracking	
Asset	Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Finding Creation Date	12/04/2023 15:24:33	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	

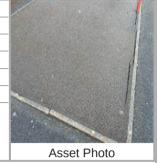



Surface - Cracking - Task

Task Title	Repair surface	



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Sevi	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L(8)	M (12)	H (16)	H (20)
kelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
mul o ni the tol	• 1: The total risk scores included within tipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the rise two numbers are then multiplied total risk score that is shown against defeaters.	lhood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	t be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.







Safety Inspection Report

Llanelli Rural Council Cynheidre Play Area Feb 2025

Working in harmony with











Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	\(\)
Site Name	Cynheidre Play Area	
Actual Date	10/02/2025 16:03:32	
Inspection Type	Playground-Annual	/ / / \
Inspector	Wayne Hock	/ / / \
Inspection Status	Completed	
		10/02/2025



Finding Summary

Cynheidre Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Entrance - Gate	Gate - Self-Closing - Adjustment	22/03/2023 20:26:24	Low
Multiplay Unit	Item - Loose in Ground	22/03/2023 20:57:20	Low
Multiplay Unit	Metal - Excessive Corrosion	22/03/2023 20:57:50	Low
Multiplay Unit	Item - Bolt(s) loose	22/03/2023 20:58:39	Low
Multiplay Unit	Handrails - Required	22/03/2023 20:59:12	Low
Multiplay Unit - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	22/03/2023 21:00:43	Low
Multiplay Unit - Surface - Wet Pour	Impact Area - Extent	22/03/2023 21:01:41	Low



Inspection - Cynheidre Play Area - 10/02/2025 16:03:32

Provider	Provider	/ / I
Site Name	Cynheidre Play Area	/ / / / / /
Actual Date	10/02/2025 16:03:32	/
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10/02/2020

Site Name	Cynheidre Play Area
Address	Myrtle Hill Cynheidre
Postcode	SA155YD
Notes	
Site Owner	Llanelli Rural Council

Cynheidre Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Cynheidre Play Area	
Asset Type	Children's Playground	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	

Entrance - Gate	
Entrance	
Perimeter	
	Mil. Committee parket
Low	(1) (1) (1) (1) (1) (1) (1) (1) (1) (1)
5	7.0
	Entrance Perimeter Low





Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Litter Bin	
Asset Type	Bins	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	



ltiplay
uipment (Outdoor Play)
P (Playgrounds) Ltd
V





Multiplay Unit - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
5



Asset Name	Rocker - Spring Horse
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	·



Asset Name	Rocker - Spring Horse - Surface - Bark
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Seating - Bench	
Asset Type	Seating	The state of the s
Asset Category	Facilities	000
Manufacturer		MANA
EN Compliant		E () ()
Risk Level	Very Low	
Risk Score	3	i de la companya de
		8638



Asset Name	Signage - Playground	
Asset Type	Signage	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Entrance - Gate - Finding

Finding Title	Gate - Self-Closing - Adjustment	
Asset	Entrance - Gate	
Finding Creation Date	22/03/2023 20:26:24	April Companii Ilin
Finding Group	Maintenance	₩
Finding Notes		
Risk Level	Low	A DESCRIPTION OF THE PERSON OF





Gate - Self-Closing - Adjustment - Task

Task Title	Adjust self-closure mechanism



Multiplay Unit - Findings

Finding Title	Handrails - Required
Asset	Multiplay Unit
Finding Creation Date	22/03/2023 20:59:12
Finding Group	BS EN 1176:2017 Part 1 (General - Playground)
Finding Notes	Hand a rail doesn't extend to bottom step
Risk Level	Low





Handrails - Required - Task

	•
Task Title	No action given the risk assessment



Finding Title	Item - Bolt(s) loose	I
Asset	Multiplay Unit	1
Finding Creation Date	22/03/2023 20:58:39	ı
Finding Group	Maintenance	ı
Finding Notes	Panel Bolt loose	ı
Risk Level	Low	ı
		Į,





Item - Bolt(s) loose - Task

Task Title	Tighten loose fixtures & fittings



Finding Title	Metal - Excessive Corrosion	1
Asset	Multiplay Unit	
Finding Creation Date	22/03/2023 20:57:50	
Finding Group	Maintenance	
Finding Notes	Treat and Paint Corrosion	
Risk Level	Low	



Asset Photo



Finding Photos



Metal - Excessive Corrosion - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Finding Title	Item - Loose in Ground	Ī
Asset	Multiplay Unit	1
Finding Creation Date	22/03/2023 20:57:20	
Finding Group	Maintenance	
Finding Notes		1
Risk Level	Low	
		- 1



Asset Photo





Item - Loose in Ground - Task

Task Title	No action given the risk assessment



Multiplay Unit - Surface - Wet Pour - Findings

Finding Title	Impact Area - Extent	1 8 B
Asset	Multiplay Unit - Surface - Wet Pour	(August
Finding Creation Date	22/03/2023 21:01:41	
Finding Group	BS EN 1176:2017 Part 1 (General - Playground)	
Finding Notes		47
Risk Level	Low	



Asset Photo

Finding Photos



Impact Area - Extent - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Finding Title	Surface - Perimeter of Surface Shrunk from Edgings
Asset	Multiplay Unit - Surface - Wet Pour
Finding Creation Date	22/03/2023 21:00:43
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Finding Photos



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.





This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the reset wo numbers are then multiplied total risk score that is shown against defeaters.	lhood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a to ould be a Likelihood (3) x Severity (4) o Severity (3).					Severit	У	λ

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with PSS Live+





Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG



Safety Inspection Report

Llanelli Rural Council Dafan Park Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with PSSLive+



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	/ A
Site Name	Dafan Park	/ 04 1
Actual Date	10/02/2025 12:19:55	/ / // \
Inspection Type	Playground-Annual	/ / // \ \ \
Inspector	Wayne Hock	/ // \/
Inspection Status	Completed	
		10/02/2025



Finding Summary

Dafan Park Findings

Asset	Finding Title	Creation Date	Risk Level
Multiplay Unit	Item - Cap(s) damaged	23/03/2023 17:42:32	Medium
Multiplay Unit	Item - Worn Edges	10/02/2025 12:27:36	Medium
Rocker - Spring Seesaw - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	23/03/2023 17:27:44	Low
Rope Climber - Surface - Wet Pour	Surface - Debris	23/03/2023 17:34:04	Low
Rope Climber	Worn Edges	23/03/2023 17:35:00	Low
Swing - 1Bay Mixed Seat	Item - Cap(s) missing	23/03/2023 17:37:42	Low
Multiplay Unit	Item - Rubber missing	23/03/2023 17:41:43	Low
Multiplay Unit	Item - Re-paint	23/03/2023 17:42:55	Low
Fencing - Bowtop	Item - Cap missing	23/03/2023 17:45:48	Low
Fitness Station	Item - Not Working	23/03/2023 17:51:16	Low
Swing - 1Bay Mixed Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	10/02/2025 12:22:45	Low
Multiplay - Toddler - Surface - Wet Pour	Surface - Wearing	10/02/2025 12:24:12	Low
Rocker - Spring Seesaw - Surface - Wet Pour	Surface - Holes	10/02/2025 12:26:13	Low



Inspection - Dafan Park - 10/02/2025 12:19:55

Provider	Provider	$\int \int $
Site Name	Dafan Park	/
Actual Date	10/02/2025 12:19:55	/
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10,02,2020

Site Name	Dafan Park
Address	Off Maescanner Road Dafan
Postcode	SA148LR
Notes	
Site Owner	Llanelli Rural Council

Dafan Park Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Dafan Park	
Asset Type	Children's Playground	(5) · · · · · · · · · · · · · · · · · ·
Asset Category	Site	7
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
		美術 小型 (1)

Asset Name	Entrance - Gate	
Asset Type	Entrance	
Asset Category	Perimeter	Section 1
Manufacturer		With Street or March 1997
EN Compliant		
Risk Level	Low	ALTON DE LA CONTRACTION DEL CONTRACTION DE LA CO
Risk Score	4	And Control of the Co
	·	



Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	



Outdoor Fitness (Gym Style)
Equipment (Outdoor Fitness)
Bespoke
⁄es
.OW
,
36



Asset Name	Fitness Station - Surface - Grass
Asset Type	General Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Litter Bin	86
Asset Type	Bins	
Asset Category	Facilities	
Manufacturer		
EN Compliant		Į.
Risk Level	Very Low	1
Risk Score	3	
		<u> </u>



Asset Name	Multiplay - Toddler
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Vinci Play
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Multiplay - Toddler - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play (SW) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	6



Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Spring Seesaw	
Asset Type	Rocker	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	SMP (Playgrounds) Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	





Surface ce
се



Asset Name	Rope Climber
Asset Type	Climbing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rope Climber - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	6





Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Swing - 1Bay Mixed Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Vinci Play
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Swing - 1Bay Mixed Seat - Surface - Wet Pour	
Asset Type	Safer Surface	7
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	* A
Risk Score	5	






Findings and Tasks reported within the Inspection

Multiplay - Toddler - Surface - Wet Pour - Finding

Finding Title	Surface - Wearing	LUZ
Asset	Multiplay - Toddler - Surface - Wet Pour	
Finding Creation Date	10/02/2025 12:24:12	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		A CONTRACTOR OF THE PARTY OF TH

Finding Photos

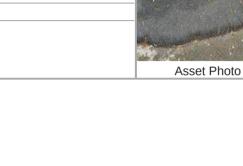

Surface - Wearing - Task

Task Title	Repair surface



Multiplay Unit - Findings

Finding Title	Item - Worn Edges
Asset	Multiplay Unit
Finding Creation Date	10/02/2025 12:27:36
Finding Group	Maintenance
Finding Notes	
Risk Level	Medium







Item - Worn Edges - Task

Task Title	Repair edges



Rocker - Spring Seesaw - Surface - Wet Pour - Findings

Finding Title	Surface - Holes
Asset	Rocker - Spring Seesaw - Surface - Wet Pour
Finding Creation Date	10/02/2025 12:26:13
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Surface - Holes - Task

Task Title	Repair surface



Swing - 1Bay Mixed Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	7
Asset	Swing - 1Bay Mixed Seat - Surface - Wet Pour	
Finding Creation Date	10/02/2025 12:22:45	
Finding Group	Maintenance	100 V
Finding Notes		
Risk Level	Low	2.1





Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Previously Reported Findings and Tasks (unresolved at time of Inspection)

Fencing - Bowtop - Finding

Finding Title	Item - Cap missing	
Asset	Fencing - Bowtop	
Finding Creation Date	23/03/2023 17:45:48	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	





Item - Cap missing - Task

Task Title	Replace item

Fitness Station - Finding

Asset Fitne	C: ::	
710001	ess Station	
Finding Creation Date 23/0	03/2023 17:51:16	
Finding Group Mair	ntenance	
Finding Notes		<u> </u>
Risk Level Low		
		Asset Photo



Item - Not Working - Task

Task Title	Repair item

Multiplay Unit - Findings

Item - Re-paint	
Multiplay Unit	
23/03/2023 17:42:55	
Maintenance	
Low	
	Multiplay Unit 23/03/2023 17:42:55 Maintenance



Asset Photo



Finding Photos



Item - Re-paint - Task

Task Title	Paint and Refurbish



Item - Cap(s) damaged	
Multiplay Unit	
23/03/2023 17:42:32	
Maintenance	
Medium	
	Multiplay Unit 23/03/2023 17:42:32 Maintenance



Asset Photo



Item - Cap(s) damaged - Task

Task Title	Replace item



Finding Title	Item - Rubber missing
Asset	Multiplay Unit
Finding Creation Date	23/03/2023 17:41:43
Finding Group	Maintenance
Finding Notes	Rubber edging missing
Risk Level	Low



Asset Photo



Finding Photos



Item - Rubber missing - Task

Task Title	Replace item



Rocker - Spring Seesaw - Surface - Wet Pour - Findings

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	N.
Asset	Rocker - Spring Seesaw - Surface - Wet Pour	To the second
Finding Creation Date	23/03/2023 17:27:44	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		ø



Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Rope Climber - Finding

Finding Title	Vorn Edges	
Asset	Rope Climber	
Finding Creation Date	23/03/2023 17:35:00	
Finding Group	aintenance	
Finding Notes	Ropework worn	
Risk Level	Low	



Asset Photo

Finding Photos



Worn Edges - Task

Task Title	Repair edges



Rope Climber - Surface - Wet Pour - Finding

Finding Title	Surface - Debris	
Asset	Rope Climber - Surface - Wet Pour	
Finding Creation Date	23/03/2023 17:34:04	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	132







Surface - Debris - Task

Task Title	Remove debris



Swing - 1Bay Mixed Seat - Finding

Finding Title	Item - Cap(s) missing	
Asset	Swing - 1Bay Mixed Seat	
Finding Creation Date	23/03/2023 17:37:42	
Finding Group	Maintenance	
Finding Notes		m A
Risk Level	Low	
		Asset Photo





Item - Cap(s) missing - Task

Task Title	Replace



Findings and Tasks Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
Lik	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mu o n the	e 1: The total risk scores included within ltipication factor of the calculated Likeling each finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tall risk score that is shown against defeaters.	lhood erity a natrix gethe	and Severity are given a above and r to give the	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tol ould be a Likelihood (3) x Severity (4) or					Severit	У	
	Severity (3).							

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with **PSSLive**⁺







Britar nia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG



Safety Inspection Report

Llanelli Rural Council Dan Y Banc Play Area Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with PSSLive⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	1.1
Site Name	Dan Y Banc Play Area	1 / \ 1\
Actual Date	14/02/2025 11:21:00	
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	1 /////
Inspection Status	Completed	1 // I V
		12/02/2025



Finding Summary

Dan Y Banc Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Agility - Balance Trail	Item - Not Secure	20/04/2023 20:51:20	Low
Swing - 2Bay Mixed Seats	Chain - Connectors Worn	20/04/2023 20:53:33	Low
Swing - 2Bay Mixed Seats	Item - Not Secure	20/04/2023 20:53:55	Low
Spinning Bowl	Carousel - Bearings - Worn	20/04/2023 20:58:25	Low
Signage - playground	Item - Hard or Sharp Projections	20/04/2023 21:02:13	Low
Entrance - Gate	Item - Loose in Ground	20/04/2023 21:03:34	Low



Inspection - Dan Y Banc Play Area - 14/02/2025 11:21:00

Provider	Provider	/ ^[\
Site Name	Dan Y Banc Play Area	/^H
Actual Date	14/02/2025 11:21:00	//\\`
Inspection Type	Playground-Annual	,,,
Inspector	Wayne Hock	12/02/2025
Inspection Status	Completed	

Site Name	Dan Y Banc Play Area
Address	Dan Y Banc Road Felinfoel
Postcode	SA155UW
Notes	
Site Owner	Llanelli Rural Council

Dan Y Banc Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Dan Y Bryn Play Area	
Asset Type	Children's Playground	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
	· · · · · · · · · · · · · · · · · · ·	



Asset Name	Agility - Balance Trail
Asset Type	Agility
Asset Category	Equipment (Outdoor Play)
Manufacturer	Vinci Play
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Agility - Balance Trail - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Ball Court	
Ball Play	
Equipment (Multi Sports)	
Record RSS Ltd	
Yes	
Low	
6	
	Ball Play Equipment (Multi Sports) Record RSS Ltd Yes



Asset Name	Ball Court - Surface - Bitmac
Asset Type	Hard Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Entrance - Double Gate	
Asset Type	Entrance	No.
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
		9 5



Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Litter Bin
Bins
Facilities
Very Low
3





Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Vinci Play
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Multiplay Unit - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	<u>'</u>



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Asset Name	Spinning Bowl
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Vinci Play
EN Compliant	Yes
Risk Level	Low
Risk Score	6
RISK Score	O



Asset Name	Spinning Bowl - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	'



Swing - 2Bay Mixed Seats	
Swing	
Equipment (Outdoor Play)	
Vinci Play	
Yes	
Low	
5	





Asset Name	Swing - 2Bay Mixed Seats - Surface - Grass Mat	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	128 288 977 1
Risk Level	Low	
Risk Score	4	100 Sept. 100 Se
		A STREET, SAN ON BEING A STREET, WHILE WITH WITH



Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Agility - Balance Trail - Finding

Finding Title	Item - Not Secure	8
Asset	Agility - Balance Trail	7
Finding Creation Date	20/04/2023 20:51:20	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	60%
		0.5







Item - Not Secure - Task

Task Title	Repair item



Entrance - Gate - Finding

Finding Title	Item - Loose in Ground
Asset	Entrance - Gate
Finding Creation Date	20/04/2023 21:03:34
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Finding Photos



Item - Loose in Ground - Task

Task Title	Secure and make stable main frame and supports



Signage - playground - Finding

Finding Title	Item - Hard or Sharp Projections	
Asset	Signage - playground	
Finding Creation Date	20/04/2023 21:02:13	Croeso i Lle Chwarae Da Welcome to Danyban Pi
Finding Group	Maintenance	Projection of the Control of the Con
Finding Notes		WW
Risk Level	Low	GETTING .





Item - Hard or Sharp Projections - Task

Task Title	Remove hard, pointed & sharp projections



Spinning Bowl - Finding

Finding Title	Carousel - Bearings - Worn	
Asset	Spinning Bowl	
Finding Creation Date	0/04/2023 20:58:25	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	







Carousel - Bearings - Worn - Task

Task Title	Replace item



Swing - 2Bay Mixed Seats - Findings

Finding Title	Item - Not Secure
Asset	Swing - 2Bay Mixed Seats
Finding Creation Date	20/04/2023 20:53:55
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo

Finding Photos



Item - Not Secure - Task

Task Title	Repair item	



Finding Title	Chain - Connectors Worn
Asset	Swing - 2Bay Mixed Seats
Finding Creation Date	20/04/2023 20:53:33
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo





Chain - Connectors Worn - Task

Task Title	Replace worn parts



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.





This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Commence Co.	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mu o n the	e 1: The total risk scores included within ltipication factor of the calculated Likeling each finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tall risk score that is shown against defeaters.	lhood erity a natrix gethe	and Severity are given a above and r to give the	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x				Severit	У			
	Severity (3).							

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with

🔽 sales@dragonplay.co.uk

02922 677190

Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG



Annual Inspection

Safety Inspection Report

Llanelli Rural council Felin Foel Rec Play Area Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with **PSSLive**⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	
Site Name	Felinfoel Recreation Ground Play Area	
Actual Date	06/02/2025 14:33:00	
Inspection Type	Playground-Annual	- (Λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ λ
Inspector	Wayne Hock	
Inspection Status	Completed	
		12/02/2025



Finding Summary

Felinfoel Recreation Ground Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Entrance - Gate	Gate - Self-Closing - Adjustment	20/04/2023 21:51:59	Low
Multiplay Unit - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:00:40	Low
Play Panel	Item - Bolt(s) loose	20/04/2023 22:02:50	Low
Swing 1Bay Toddler Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:05:20	Low
Swing - 2Bay Basket/Junior Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:08:19	Low
Swing - 2Bay Basket/Junior Seat	Chain - Bushes Worn	20/04/2023 22:08:53	Low
Play Feature - Dragon Rock - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:14:08	Low
Multiplay - Toddler - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:18:57	Low
Carousel - Flush - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	20/04/2023 22:26:34	Low
Carousel - Flush	Carousel - Bearings - Require service	20/04/2023 22:26:54	Low



Inspection - Felinfoel Recreation Ground Play Area - 06/02/2025 14:33:00

Provider	Provider	/ ^ >
Site Name	Felinfoel Recreation Ground Play Area	M
Actual Date	06/02/2025 14:33:00	
Inspection Type	Playground-Annual	12/02/2025
Inspector	Wayne Hock	12/02/2025
Inspection Status	Completed	

Site Name	Felinfoel Recreation Ground Play Area
Address	Felinfoel Rec Ynyswen
Postcode	SA148BE
Notes	
Site Owner	Llanelli Rural Council

Felinfoel Recreation Ground Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Felinfoel Rec Play Area	
Asset Type	Children's Playground	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
	·	

Asset Name	Carousel - Flush	
Asset Type	Carousel	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Wicksteed Leisure Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	6	
INION OCCITE	U	The second second



Carousel - Flush - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
5



Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Asset Name	Entrance - Maintenance Gate	
Asset Type	Entrance	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	





Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Fencing - High Outer Mesh	
Asset Type	Fencing	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Multiplay - Toddler	
Multiplay	
Equipment (Outdoor Play)	
Wicksteed Leisure Ltd	
Yes	
Low	
5	
	Multiplay Equipment (Outdoor Play) Wicksteed Leisure Ltd Yes Low



Asset Name	Multiplay - Toddler - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	<u>'</u>



Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Play Feature - Dragon Rock
Asset Type	Social Play
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	6



Asset Name	Play Feature - Dragon Rock - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Play Panel
Social Play
Equipment (Outdoor Play)
Wicksteed Leisure Ltd
Yes
Low
4
- -



Play Panel - Surface - Bitmac	
Hard Surface	
Surface	
Yes	
Low	
4	
	Hard Surface Surface Yes



Asset Name	Rocker - Spring Dragon (A)
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rocker - Spring Dragon (A) - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Dragon (B)
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Dragon (B) - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Seating - Mushroom
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	·



Asset Name	Seating - Picnic Table	
Asset Type	Seating	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	





Asset Name	Signage - Opening Times
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Swing - 2Bay Basket/Junior Seat			
Asset Type	Swing			
Asset Category	Equipment (Outdoor Play)			
Manufacturer	Wicksteed Leisure Ltd			
EN Compliant	Yes			
Risk Level	Low			
Risk Score	5			
Risk Score	5			





Asset Name	Swing - 2Bay Basket/Junior Seat - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	

1		\geq	
	A		
Villa I		A STATE OF THE STA	

Asset Name	Swing - 2Bay Toddler Seat			
Asset Type	Swing			
Asset Category	Equipment (Outdoor Play)			
Manufacturer	Wicksteed Leisure Ltd			
EN Compliant	Yes			
Risk Level	Low			
Risk Score	5			
	'			



Asset Name	Swing 1Bay Toddler Seat - Surface - Wet Pour			
Asset Type	Safer Surface			
Asset Category	Surface			
Manufacturer				
EN Compliant	Yes			
Risk Level	Low			
Risk Score	4			





Asset Name	Talk Tubes
Asset Type	Social Play
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4
RISK Score	4



Asset Name	Talk Tubes - Surface - Wet Pour/Bitmac			
Asset Type	Safer Surface			
Asset Category	Surface			
Manufacturer				
EN Compliant	Yes			
Risk Level	Low			
Risk Score	4			





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Carousel - Flush - Finding


inding Title	Carousel - Bearings - Require service	
sset	Carousel - Flush	
inding Creation Date	20/04/2023 22:26:54	
inding Group	Maintenance	
inding Notes	Bearing worn causing outer platform edge to be a potential shearing hazard	
isk Level	Low	
		Asset Photo
		Asset F

Carousel - Bearings - Require service - Task

Task Title	Service item

Carousel - Flush - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Carousel - Flush - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:26:34	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
I		Asset Photo

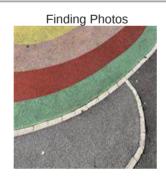



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface

Entrance - Gate - Finding

Finding Title	Gate - Self-Closing - Adjustment	N.
Asset	Entrance - Gate	
Finding Creation Date	20/04/2023 21:51:59	
Finding Group	Maintenance	3
Finding Notes		N
Risk Level	Low	
		-







Gate - Self-Closing - Adjustment - Task

Task Title	Adjust self-closure mechanism	



Multiplay - Toddler - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Multiplay - Toddler - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:18:57	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	



Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Multiplay Unit - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	1
Asset	Multiplay Unit - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:00:40	Z
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	







Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface

Play Feature - Dragon Rock - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Play Feature - Dragon Rock - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:14:08	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	Starley.
		Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface

Play Panel - Finding

Finding Title	Item - Bolt(s) loose	×
Asset	Play Panel	Š
Finding Creation Date	20/04/2023 22:02:50	100
Finding Group	Maintenance	i
Finding Notes		
Risk Level	Low	





Item - Bolt(s) loose - Task

Task Title	Tighten loose fixtures & fittings



Swing - 2Bay Basket/Junior Seat - Finding

Finding Title	Chain - Bushes Worn	
Asset	Swing - 2Bay Basket/Junior Seat	
Finding Creation Date	20/04/2023 22:08:53	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	V
		Asset Photo

Chain - Bushes Worn - Task

Task Title	Replace bushes

Swing - 2Bay Basket/Junior Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Swing - 2Bay Basket/Junior Seat - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:08:19	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo

Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Asset Photo

Swing 1Bay Toddler Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	St. H. William
Asset	Swing 1Bay Toddler Seat - Surface - Wet Pour	
Finding Creation Date	20/04/2023 22:05:20	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		A CONTRACTOR OF THE PARTY OF TH



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mu o n the	e 1: The total risk scores included within ltipication factor of the calculated Likeling each finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	lhood erity a natrix gethe	and Severity are given a above and r to give the	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tol ould be a Likelihood (3) x Severity (4) or					Severit	У	
	Severity (3).							

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.





Annual Inspection

Safety Inspection Report

Llanelli Rural Council Heol Gwilli Ball Court Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with PSSLive+



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

-	
Provider	<u> </u>
Heol Gwili Ball Court	
10/02/2025 11:21:35	/ //
Playground-Annual	
Wayne Hock	/ // \/
Completed	
	() 0
	10/02/2025
	Heol Gwili Ball Court 10/02/2025 11:21:35 Playground-Annual Wayne Hock

Finding Summary

Heol Gwili Ball Court Findings

Asset	Finding Title	Creation Date	Risk Level			
Multi Use Games Area	Fixtures - Loose or Missing	20/03/2023 14:39:01	Low			
Multi Use Games Area	Item - Corrosion	20/03/2023 14:39:57	Low			
Signage	Item - Hard or Sharp Projections	20/03/2023 14:42:15	Low			



Inspection - Heol Gwili Ball Court - 10/02/2025 11:21:35

Provider	Provider	-
Site Name	Heol Gwili Ball Court	
Actual Date	10/02/2025 11:21:35	
Inspection Type	Playground-Annual	(
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10,02,2020

Site Name	Heol Gwili Ball Court
Address	Heol Gwili Llanelli
Postcode	SA149HW
Notes	
Site Owner	Llanelli Rural Council

Heol Gwili Ball Court Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Heol Gwili Ball Court	
Asset Type	Sports Areas	
Asset Category	Site	CTW . L
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	

Asset Name	Litter Bin	
Asset Type	Bins	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	· · · · · · · · · · · · · · · · · · ·
		PART TO THE PROPERTY OF THE PART OF THE PA
		and the state of t



Asset Name	Multi Use Games Area	
Asset Type	Ball Play	
Asset Category	Equipment (Multi Sports)	
Manufacturer	SMP (Playgrounds) Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	6	
	:	The state of the s



Asset Name	Multi Use Games Area - Surface - Bitmac
Asset Type	Hard Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5

Asset Name	Signage	
Asset Type	Signage	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	
	•	



Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Multi Use Games Area - Findings

Finding Title	Item - Corrosion	
Asset	Multi Use Games Area	
Finding Creation Date	20/03/2023 14:39:57	
Finding Group	Maintenance	. At
Finding Notes	Corrosion on panels	
Risk Level	Low	1 294
	<u>'</u>	







Finding Photos



Item - Corrosion - Task

Task Title	Repair item



Finding Title	Fixtures - Loose or Missing	I
Asset	Multi Use Games Area	
Finding Creation Date	20/03/2023 14:39:01	
Finding Group	Maintenance	
Finding Notes	Bolts loose and missing on panels	
Risk Level	Low	1
		1



Asset Photo



Fixtures - Loose or Missing - Task

Task Title	Tighten loose fixtures & fittings



Asset Photo

Signage - Finding

Finding Title	Item - Hard or Sharp Projections	
Asset	Signage	
Finding Creation Date	20/03/2023 14:42:15	
Finding Group	Maintenance	
Finding Notes	Projecting bolt threads	
Risk Level	Low	



Item - Hard or Sharp Projections - Task

Task Title	Remove hard, pointed & sharp projections



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L(8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
24110				1	2	3	4	5
mu n the	te 1: The total risk scores included within Itipication factor of the calculated Likelin of each finding. Both Likelihood and Sevumber between 1 - 5 as shown on the masses two numbers are then multiplied to tal risk score that is shown against defen Total risk scores	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tol ould be a Likelihood (3) x Severity (4) or					Severit	у	
	Severity (3).							

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with





Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG



Safety Inspection Report

Llanelli Rural Council Park Elin Mair Play Area Feb 2025

www.dragonplay.co.uk

sales@dragonplay.co.uk

02922 677190

Working in harmony with **PSSLive**⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

mopootione moid	ded in this report	
Provider	Provider	
Site Name	Park Elin Mair Play Area	/ /\
Actual Date	10/02/2025 13:14:54	/ / / /
Inspection Type	Playground-Annual	/ ,
Inspector	Wayne Hock	
Inspection Status	Completed	
		/ / ' '
		() 0
		10/02/2025



Finding Summary

Park Elin Mair Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Ball Shoot	Metal - Excessive Corrosion	23/03/2023 08:19:07	Medium
Carousel	Item - Re-paint	23/03/2023 08:00:52	Low
Rocker - Seesaw - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	23/03/2023 08:02:33	Low
Agility - Balance Trail	Item - Bolt missing	23/03/2023 08:05:58	Low
Swing - 1Bay Basket Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	23/03/2023 08:09:23	Low
Swing - 1Bay Basket Seat	Group-Use - Type 1 - Secondary Support	23/03/2023 08:09:42	Low
Multiplay Unit - Surface - Tiles	Surface - Tiles - Gaps	23/03/2023 08:13:08	Low
Multiplay Unit - Surface - Tiles	Impact Area - Extent	23/03/2023 08:14:27	Low
Multiplay Unit	Stairs - Treads - Depth	23/03/2023 08:15:08	Low
Ball Shoot - Surface - Grass	Surface - Poor Drainage	23/03/2023 08:18:25	Low



Inspection - Park Elin Mair Play Area - 10/02/2025 13:14:54

Provider	Provider	<u> </u>
Site Name	Park Elin Mair Play Area	_/
Actual Date	10/02/2025 13:14:54	
Inspection Type	Playground-Annual	_(<i>/U </i>
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	

Site Name	Park Elin Mair Play Area	
Address	Heol Hen Five Roads	
Postcode	SA155HJ	
Notes		
Site Owner	Llanelli Rural Council	

Park Elin Mair Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Park Elin Mair	
Asset Type	Children's Playground	L WINDS
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	

Asset Name	Agility - Balance Trail	
Asset Type	Agility	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Record RSS Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	6	
		STATE OF THE STATE



Asset Name	Agility - Balance Trail - Surface - Bark	37
Asset Type	Safer Surface	1
Asset Category	Surface	
Manufacturer		100
EN Compliant	Yes	200
Risk Level	Low	
Risk Score	5	9
		



Ball Shoot	
Ball Play	
Equipment (Multi Sports)	
Record RSS Ltd	
Yes	
Low	
7	
	Ball Play Equipment (Multi Sports) Record RSS Ltd Yes



Asset Name	Ball Shoot - Surface - Grass
Asset Type	General Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	7





Carousel
Carousel
Equipment (Outdoor Play)
Record RSS Ltd
Yes
Low
5



Asset Name	Carousel - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Entrance - Gate
Entrance
Perimeter
Low
5





Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Litter Bin	P
Asset Type	Bins	
Asset Category	Facilities	N
Manufacturer		
EN Compliant		2
Risk Level	Very Low	
Risk Score	3	£



Multiplay Unit
Multiplay
Equipment (Outdoor Play)
SMP (Playgrounds) Ltd
No
Low
6
_





Asset Name	Multiplay Unit - Surface - Tiles
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	No
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Seesaw	V
Asset Type	Rocker	ı
Asset Category	Equipment (Outdoor Play)	-
Manufacturer	Record RSS Ltd	Maria
EN Compliant	Yes	
Risk Level	Low	ı
Risk Score	5	1
		1



Rocker - Seesaw - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
5
- - -





Asset Name	Rocker - Spring Car
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Car - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Elephant
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rocker - Spring Elephant - Surface - Wet Pour)
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	



Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



eating
acilities
DW .





Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Swing - 1Bay Basket Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	No
Risk Level	Low
Risk Score	5
	·



Safer Surface
Surface
Yes
Low
5





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Agility - Balance Trail - Finding

<u> </u>		
Finding Title	Item - Bolt missing	
Asset	Agility - Balance Trail	The state of the s
Finding Creation Date	23/03/2023 08:05:58	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Accet Dhete
		Asset Photo

Item - Bolt missing - Task

Task Title	Replace item

Ball Shoot - Finding

Finding Title	Metal - Excessive Corrosion	
Asset	Ball Shoot	
Finding Creation Date	23/03/2023 08:19:07	
Finding Group	Maintenance	
Finding Notes	Unit has come to the end of it's life expectancy	
Risk Level	Medium	



Asset Photo









Asset Photo

Metal - Excessive Corrosion - Task

Task Title	Replace item

Ball Shoot - Surface - Grass - Finding

Finding Title	Surface - Poor Drainage	
Asset	Ball Shoot - Surface - Grass	
Finding Creation Date	23/03/2023 08:18:25	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	



Surface - Poor Drainage - Task

Task Title	Provide adequate drainage



Carousel - Finding

Finding Title	Item - Re-paint
Asset	Carousel
Finding Creation Date	23/03/2023 08:00:52
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo





Item - Re-paint - Task

Task Title	Paint and Refurbish



Multiplay Unit - Findings

Finding Title	Stairs - Treads - Depth	0 400 300
Asset	Multiplay Unit	The state of the s
Finding Creation Date	23/03/2023 08:15:08	= 1
Finding Group	BS EN 1176:2017 Part 1 (General - Playground)	
Finding Notes		
Risk Level	Low	



Finding Photos



Stairs - Treads - Depth - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Multiplay Unit - Surface - Tiles - Findings

Finding Title	Impact Area - Extent
Asset	Multiplay Unit - Surface - Tiles
Finding Creation Date	23/03/2023 08:14:27
Finding Group	BS EN 1176:2017 Part 1 (General - Playground)
Finding Notes	
Risk Level	Low
	'







Impact Area - Extent - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Finding Title Surface - Tiles - Gaps	
Multiplay Unit - Surface - Tiles	
Finding Creation Date 23/03/2023 08:13:08	
Maintenance	
Low	



Asset Photo



Surface - Tiles - Gaps - Task

Task Title	Re-glue tiles



Rocker - Seesaw - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Rocker - Seesaw - Surface - Wet Pour	
Finding Creation Date	23/03/2023 08:02:33	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	



Finding Photos



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Swing - 1Bay Basket Seat - Finding

Finding Title Group-Use - Type 1 - Secondary Support		9
Asset	Swing - 1Bay Basket Seat	2000
Finding Creation Date 23/03/2023 08:09:42		100
Finding Group BS EN 1176:2017 Part 2 (Swings - Playground)		
Finding Notes		Ì
Risk Level	Low	
		- 0



Asset Photo

Finding Photos



Group-Use - Type 1 - Secondary Support - Task

Task Title No action required, based on risk assessment, as asset pre-dates EN 1176	



Swing - 1Bay Basket Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Swing - 1Bay Basket Seat - Surface - Wet Pour	
Finding Creation Date	23/03/2023 08:09:23	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within Itipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.









Britannia House, 3 Caerphilly
Business Park, Caerphilly
CF83 3GG



Safety Inspection Report

Llanelli Rural council Ponthenri Play Area Feb 2025

Working in harmony with











Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	. 1
Site Name	Ponthenri Play Area	
Actual Date	10/02/2025 15:34:09	/ ///
Inspection Type	Playground-Annual	/ /// \\
Inspector	Wayne Hock	/ //\ \\ /\
Inspection Status	Completed	
		10/02/2025

Finding Summary

Ponthenri Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Trampoline	Surface - Poor Drainage	10/02/2025 15:49:03	Medium
Swing - 1Bay Basket Seat	Group-Use - Type 1 - Secondary Support	10/02/2025 15:47:26	Low
Double Cable Runway - Surface - Grass Mat	Surface - Uneven	10/02/2025 15:54:37	Low



Inspection - Ponthenri Play Area - 10/02/2025 15:34:09

Provider	Provider	(1)
Site Name	Ponthenri Play Area	
Actual Date	10/02/2025 15:34:09	
Inspection Type	Playground-Annual	-
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10/02/2020

Site Name	Ponthenri Play Area
Address	Ponthenri Llanelli
Postcode	
Notes	
Site Owner	Llanelli Rural Council

Ponthenri Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Ponthenri Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	



Asset Name	Agility - Balance Trail
Asset Type	Agility
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	





Asset Name	Agility - Balance Trail - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score		

Asset Name	Carousel
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	
	·



Carousel - Surface - Wet Pour
Safer Surface
Surface
Yes
Low





Double Cable Runway	- 1
Cableway	
Equipment (Outdoor Play)	
Yes	_
Low	
	Cableway Equipment (Outdoor Play) Yes



Double Cable Runway - Surface - Grass Mat	
Safer Surface	
Surface	
Yes	
Low	
-	Safer Surface Surface Yes



Entrance - Gates
Entrance
Perimeter
Low





Asset Name	Games Wall
Asset Type	Ball Play
Asset Category	Equipment (Multi Sports)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Games Wall - Surface - Bitmac	1
Asset Type	Hard Surface	1
Asset Category	Surface	100
Manufacturer		-
EN Compliant	Yes	1
Risk Level	Low	-
Risk Score		2000
	'	- 1



Asset Name	Large Multiplay
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	





Asset Name	Large Multiplay - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Multiplay
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	
Trisk ocole	



Multiplay - Surface - Grass Mat
Safer Surface
Surface
Yes
Low





Asset Name	Platform and Slide
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Platform and Slide - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Play Panel
Social Play
Equipment (Outdoor Play)
Yes
Low





Play Panel - Surface - Bitmac
Hard Surface
Surface
Yes
Low



Rocker - Spring Lady Bird
Rocker
Equipment (Outdoor Play)
Yes
Low



Asset Name	Rocker - Spring Lady Bird - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	





Asset Name	Rocket - Multi Spring Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Rocket - Multi Spring Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	





Asset Name	Signage - Playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	



Asset Name	Space Net	
Asset Type	Spatial Network	
Asset Category	Equipment (Outdoor Play)	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score		



Asset Name	Space Net - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	
Risk Score	





Asset Name	Spinning Bowl
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	



Asset Name	Spinning Bowl - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	
	·



Asset Name	Swing - 1Bay Basket Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	
EN Compliant	No
Risk Level	Low
Risk Score	





Swing - 1Bay Basket Seat - Surface - Wet Pour
Safer Surface
Surface
Yes
Low



Asset Name	Swing - 1Bay Junior Seat	П
Asset Type	Swing	
Asset Category	Equipment (Outdoor Play)	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score		



Asset Name	Swing - 1Bay Junior Seat - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	





Asset Name	Swing - 2Bay Mixed Seat	
Asset Type	Swing	
Asset Category	Equipment (Outdoor Play)	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score		
		



Asset Name	Swing - 2Bay Mixed Seat - Surface - Wet Pour			
Asset Type	Type Safer Surface			
Asset Category	Surface			
Manufacturer				
EN Compliant	Yes			
Risk Level	Low			
Risk Score				



Asset Name	Trampoline			
Asset Type	Bouncing Facility			
Asset Category	Equipment (Outdoor Play)			
Manufacturer				
EN Compliant	Yes			
Risk Level	Low			
Risk Score				
Risk Score				





Asset Name	Trampoline - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	7
Risk Score		
		BENEAVOR COLONALD DE LOCATION



Asset Photo

Findings and Tasks reported within the Inspection

Double Cable Runway - Surface - Grass Mat - Finding

Finding Title	Surface - Uneven	
Asset	Double Cable Runway - Surface - Grass Mat	Jan State St
Finding Creation Date	10/02/2025 15:54:37	
Finding Group	Maintenance	Cart to the
Finding Notes		
Risk Level	Low	



Surface - Uneven - Task

Task Title	Repair surface



Swing - 1Bay Basket Seat - Finding

Finding Title	ling Title Group-Use - Type 1 - Secondary Support			
Asset Swing - 1Bay Basket Seat				
Finding Creation Date 10/02/2025 15:47:26				
Finding Group BS EN 1176:2017 Part 2 (Swings - Playground)				
Finding Notes				
Risk Level	Low	D + 10		
		- 1		



Asset Photo

Finding Photos




Group-Use - Type 1 - Secondary Support - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176



Trampoline - Finding

Finding Title	Surface - Poor Drainage	
Asset	Trampoline	
Finding Creation Date	10/02/2025 15:49:03	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Medium	
		the main state of the state of the state of
		Asset Photo

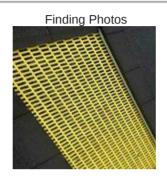

Surface - Poor Drainage - Task

Task Title	Provide adequate drainage



Previously Reported Findings and Tasks (unresolved at time of Inspection) None Recorded.



Findings and Tasks Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Sevi	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
D.	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
mul nu the tot	E1: The total risk scores included within tipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the national section of the first two numbers are then multiplied total risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with PSS Live⁺

🛜 sales@dragonplay.co.uk



Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG




Safety Inspection Report

Llanelli Rural council Pontyates Rec Play Area Feb 2025

Working in harmony with











Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	
Site Name	Pontyates Play Area	
Actual Date	10/02/2025 12:37:36	
Inspection Type	Playground-Annual	/ // // /
Inspector	Wayne Hock	
Inspection Status	Completed	1 11 1 9 1
		/ / ' \
		$\bigcup_{i} V_{i}$
		10/02/2025

Finding Summary

Pontyates Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Rota Play	Item - Moving Parts Greased	23/04/2023 07:05:14	Low
Swing - 1Bay Toddler Seat	Item - Fittings - Rusty	23/04/2023 07:15:42	Low
Agility Trail	Item - Cap(s) missing	23/04/2023 07:22:55	Low
Carousel	Type B - Ground Clearance - Low	23/04/2023 07:25:30	Low
A Site - Pontyates Play Area	Item - Not Secure	23/04/2023 07:41:40	Low



Inspection - Pontyates Play Area - 10/02/2025 12:37:36

Provider	Provider	/ / /
Site Name	Pontyates Play Area	/
Actual Date	10/02/2025 12:37:36	-//////
Inspection Type	Playground-Annual	(
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10,02,2020

Site Name	Pontyates Play Area
Address	Heol Llanelli Pontyates
Postcode	SA155UB
Notes	
Site Owner	Llanelli Rural Council

Pontyates Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Pontyates Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Agility Trail
Asset Type	Agility
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5






Asset Name	Agility Trail - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Carousel	
Asset Type	Carousel	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Wicksteed Leisure Ltd	
EN Compliant	No	
Risk Level	Low	
Risk Score	6	



Asset Name	Carousel - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4

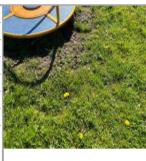



Asset Name	Entrance - Gate	
Asset Type	Entrance	4
Asset Category	Perimeter	
Manufacturer		\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
EN Compliant		
Risk Level	Low	
Risk Score	5	<u> </u>



Fencing
Perimeter
Low
4



Litter Bin
Bins
Facilities
Very Low
3





Asset Name	Multiplay - Toddler
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Multiplay - Toddler - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Multiplay
Equipment (Outdoor Play)
Wicksteed Leisure Ltd
Yes
Low
5





Asset Name	Multiplay Unit - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Spring Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rota Play
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	



Asset Name	Rota Play - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Signage - playground
Signage
Site
Low
4



Asset Name	Swing - 1Bay Mixed Seats
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Swing - 1Bay Mixed Seats - Surface - Grass Mats
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
RISK SCUIE	4





Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Swing - 1Bay Toddler Seat - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4



Asset Name	Talk Tubes
Asset Type	Social Play
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Talk Tubes - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		/ t
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	



Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

A Site - Pontyates Play Area - Finding

Finding Title	Item - Not Secure
Asset	A Site - Pontyates Play Area
Finding Creation Date	23/04/2023 07:41:40
Finding Group	Maintenance
Finding Notes	Wet Pour starting to pull away from Bitmac at edges
Risk Level	Low





Item - Not Secure - Task

Task Title	Repair item



Agility Trail - Finding

Finding Title	Item - Cap(s) missing
Asset	Agility Trail
Finding Creation Date	23/04/2023 07:22:55
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Item - Cap(s) missing - Task

Task 1	Γitle	Replace



Carousel - Finding

Finding Title	Type B - Ground Clearance - Low
Asset	Carousel
Finding Creation Date	23/04/2023 07:25:30
Finding Group	BS EN 1176:2019 Part 5 (Carousels - Playground)
Finding Notes	
Risk Level	Low





Type B - Ground Clearance - Low - Task

Task Title	No action given the risk assessment



Rota Play - Finding

Finding Title	Item - Moving Parts Greased
Asset	Rota Play
Finding Creation Date	23/04/2023 07:05:14
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Item - Moving Parts Greased - Task

Task Title	Grease moving parts



Swing - 1Bay Toddler Seat - Finding

Finding Title	Item - Fittings - Rusty	10	
Asset	Swing - 1Bay Toddler Seat		
Finding Creation Date	23/04/2023 07:15:42		
Finding Group	Maintenance		
Finding Notes		A.V BEX	A TUI
Risk Level	Low		







Item - Fittings - Rusty - Task

Task Title	Replace



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



			Severity					
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
g	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).			No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity					

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.





Safety Inspection Report

Llanelli Rural council Pwll Play Area Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with **PSSLive**⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	
Site Name	Pwll Play Area	/ / /
Actual Date	10/02/2025 13:02:21	/ / / \
Inspection Type	Playground-Annual	/ //~ \ /\
Inspector	Wayne Hock	
Inspection Status	Completed	
		10/02/2025
		10/02/2025



Finding Summary

Pwll Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Carousel - Flush	Entrapment Protection - Finger - Variable Gaps	18/04/2023 14:03:43	Medium
Carousel - Flush	Carousel - Bearings - Require service	18/04/2023 14:04:25	Medium
Rocker - Spring Sheep	Item - Corrosion	18/04/2023 13:27:11	Low
Rocker - Spring Seesaw	Fixtures - Loose or Missing	18/04/2023 13:31:29	Low
Carousel - Overhead	Carousel - Bearings - Worn	18/04/2023 13:41:54	Low
Multiplay with Attached Agility Trail	Item - Worn	18/04/2023 13:58:51	Low
Multiplay with Attached Agility Trail	Item - Not Secure	18/04/2023 14:00:17	Low



Inspection - Pwll Play Area - 10/02/2025 13:02:21

Provider	Provider	$\int \int $
Site Name	Pwll Play Area	/
Actual Date	10/02/2025 13:02:21	
Inspection Type	Playground-Annual	$-$ () \cup \vee :
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10/02/2020

Site Name	Pwll Play Area
Address	Pwll Road Pwll
Postcode	SA154AR
Notes	
Site Owner	Llanelli Rural Council

Pwll Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Pwll Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Carousel - Flush
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Park Leisure Ltd
EN Compliant	No
Risk Level	Medium
Risk Score	8





Asset Name	Carousel - Flush - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Carousel - Overhead
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Park Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	6



Asset Name	Carousel - Overhead - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	·



Asset Name	Free Rider Unit	
Asset Type	Agility	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Record RSS Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	





Free Rider Unit - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	·



Multiplay
Equipment (Outdoor Play)
Park Leisure Ltd
Yes
Low
6
ł






Asset Name	Multiplay Unit - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	

Asset Type Multiplay Asset Category Equipment (Outdoor Play) Manufacturer Park Leisure Ltd EN Compliant Yes Risk Level Low Risk Score 6	Asset Name	Multiplay with Attached Agility Trail
Manufacturer Park Leisure Ltd EN Compliant Yes Risk Level Low	Asset Type	Multiplay
EN Compliant Yes Risk Level Low	Asset Category	Equipment (Outdoor Play)
Risk Level Low	Manufacturer	Park Leisure Ltd
2010	EN Compliant	Yes
Risk Score 6	Risk Level	Low
	Risk Score	6



Asset Type Safer Su Asset Category Surface	rface			
0 1				
Manufacturer				8
manacan or				9
EN Compliant Yes				5
Risk Level Low				N.
Risk Score 4				

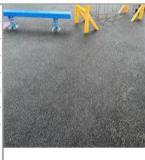



Asset Name	Play Panels - Splat/XoX
Asset Type	Social Play
Asset Category	Equipment (Outdoor Play)
Manufacturer	Park Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Play Panels - Splat/XoX - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Play Panels - Time/Maze
Social Play
Equipment (Outdoor Play)
Park Leisure Ltd
Yes
Low
4





Asset Name	Play Panels - Time/Maze - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	

Asset Name	Rocker - Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Park Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4






Asset Name	Rocker - Spring Elephant
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Bespoke
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Elephant - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4

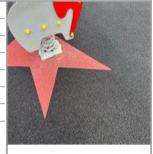


Rocker - Spring Seesaw
Rocker
Equipment (Outdoor Play)
Bespoke
Yes
Low
4





Rocker - Spring Seesaw - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4

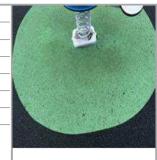

Asset Name	Rocker - Spring Sheep
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Rocker - Spring Sheep - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4





Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Seating - picnic table
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	·



Asset Name	Signage - playground	
Asset Type	Signage	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	





Swing - 1Bay Basket Seat
Swing
Equipment (Outdoor Play)
Park Leisure Ltd
Yes
Low
6



Asset Name	Swing - 1Bay Basket Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Swing - 1Bay Disabled Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Play & Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Safer Surface
Surface
Yes
Low
4



Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Park Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Swing - 1Bay Toddler Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4






ng ipment (Outdoor Play)
ipment (Outdoor Play)
/ Low
-



Asset Name	Talk Tubes	7
Asset Type	Social Play	
Asset Category	Equipment (Outdoor Play)	-/
Manufacturer	Park Leisure Ltd	-/
EN Compliant	Yes	-/
Risk Level	Low	
Risk Score	4	-/
		-/



Surface
20
, C
-

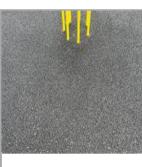



Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Carousel - Flush - Findings

	•	
Finding Title	Carousel - Bearings - Require service	
Asset	Carousel - Flush	77
Finding Creation Date	18/04/2023 14:04:25	
Finding Group	Maintenance	
Finding Notes	The unit is starting to vibrate and move in an upward motion that can cause shearing action of child put finger in gap	a
Risk Level	Medium	
		Man David
		Asset Photo



Carousel - Bearings - Require service - Task


Task Title	Service item	



Finding Title	Entrapment Protection - Finger - Variable Gaps
Asset	Carousel - Flush
Finding Creation Date	18/04/2023 14:03:43
Finding Group	BS EN 1176:2019 Part 5 (Carousels - Playground)
Finding Notes	
Risk Level	Medium



Asset Photo

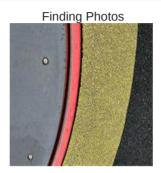

Entrapment Protection - Finger - Variable Gaps - Task

Task Title	Refer to manufacturer / supplier / installer for comment



Carousel - Overhead - Finding

	ling Title	ı
	et	
	ling Creation Date	100
	ling Group	
	ling Notes	1
	Level	N.
_		



Asset Photo





Carousel - Bearings - Worn - Task

Task Title	Repair item

Multiplay with Attached Agility Trail - Findings

Finding Title	Item - Not Secure	
Asset	Multiplay with Attached Agility Trail	. H
Finding Creation Date	18/04/2023 14:00:17	THE STATE OF THE S
Finding Group	Maintenance	
Finding Notes	Rope fitting has screw loose	
Risk Level	Low	
		Asset Photo



Item - Not Secure - Task

Task Title	Repair item

Finding Title	Item - Worn	
Asset	Multiplay with Attached Agility Trail	. 4
Finding Creation Date	18/04/2023 13:58:51	THE RESERVE TO SERVE
Finding Group	Maintenance	
Finding Notes	Tyre Eyebolts and chain worn	
Risk Level	Low	The state of the s



Asset Photo





Item - Worn - Task

Task Title	Replace	



Rocker - Spring Seesaw - Finding

Finding Title	Fixtures - Loose or Missing	
Asset	Rocker - Spring Seesaw	
Finding Creation Date	18/04/2023 13:31:29	
Finding Group	Maintenance	
Finding Notes	Over plate and fittings are loose	
Risk Level	Low	
		Asset Photo

Fixtures - Loose or Missing - Task

Task Title	Tighten loose fixtures & fittings	

Rocker - Spring Sheep - Finding

Finding Title	Item - Corrosion
Asset	Rocker - Spring Sheep
Finding Creation Date	18/04/2023 13:27:11
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo





Item - Corrosion - Task

Task Title	Repair	



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within Itipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with

(3) 02922 677190

Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG



Safety Inspection Report

Llanelli Rural Council Swiss Valley Play Area Feb 2025

www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	\wedge
Site Name	Swiss Valley Play Area	/
Actual Date	10/02/2025 11:59:09	
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	
Inspection Status	Completed	
		10/02/2025



Finding Summary

Swiss Valley Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Rota Play	Carousel - Bearings - Worn	14/04/2023 09:15:25	Low
Multiplay Unit	Item - Cap missing	14/04/2023 09:18:36	Low
Rocker - Spring Face	Item - Bolt(s) loose	14/04/2023 09:21:03	Low
Swing - Small Basket Seat	Chain - Bushes Worn	14/04/2023 09:26:07	Low
Rocker - Spring Seesaw	Item - Damaged	14/04/2023 09:28:09	Low
Carousel	Carousel - Bearings - Require service	14/04/2023 09:30:49	Low
Multiplay with Climb Wall	Item - Bolt missing	14/04/2023 09:33:54	Low
Swing - 1Bay Basket Seat	Chain - Bushes Worn	14/04/2023 09:37:11	Low
Swing - 1Bay Basket Seat	Chain - Connectors Worn	14/04/2023 09:37:48	Low



Inspection - Swiss Valley Play Area - 10/02/2025 11:59:09

Provider	Provider	$\overline{\wedge \wedge \wedge}$
Site Name	Swiss Valley Play Area	
Actual Date	10/02/2025 11:59:09	
Inspection Type	Playground-Annual	_(<i>/U </i>
Inspector	Wayne Hock	
Inspection Status	Completed	10/02/2020

Site Name Swiss Valley Play Area	
Address	Heol Nant Swiss Valley
Postcode	SA148EL
Notes	
Site Owner	Llanelli Rural Council

Swiss Valley Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Swiss Valley Play Area	
Asset Type	Children's Playground	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	



Asset Name	Agility Trail	
Asset Type	Agility	-
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Record RSS Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	6	





Asset Name	Agility Trail - Surface - Wet Pour	1
Asset Type	Safer Surface	8
Asset Category	Surface	- 8
Manufacturer		9
EN Compliant	Yes	
Risk Level	Low	9
Risk Score	5	
		9



Asset Name	Carousel
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	HAGS Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Carousel - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Entrance - Gate	
Asset Type	Entrance	88
Asset Category	Perimeter) i
Manufacturer		
EN Compliant		\ \
Risk Level	Low	
Risk Score	4	
		ų.



General Surface - Wet Pour
General Surface
Surface
Low
5



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Multiplay Unit - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4



Multiplay with Climb Wall
Multiplay
Equipment (Outdoor Play)
SMP (Playgrounds) Ltd
Yes
Low
6





Asset Name	Multiplay with Climb Wall - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	

Asset Name	Rocker - Spring Face
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Face - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rocker - Spring Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Spring Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rota Play
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	HAGS Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Rota Play - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Seating - Bench	
Asset Type	Seating	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Asset Name	Swing - 1Bay Basket Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Swing - 1Bay Basket Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
	·



Asset Name	Swing - 1Bay Junior Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Swing - 1Bay Junior Seat - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	



Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	





Swing - Small Basket Seat	
Swing	
Equipment (Outdoor Play)	
SMP (Playgrounds) Ltd	
Yes	
Low	
5	



Swing - Small Basket Seat - Surface - Wet Pour	
Safer Surface	
Surface	
Yes	
Low	
4	



Asset Name	Talk Tubes		
Asset Type	Social Play		
Asset Category	Equipment (Outdoor Play)		
Manufacturer	SMP (Playgrounds) Ltd		
EN Compliant	Yes		
Risk Level	Low		
Risk Score	4		
	<u> </u>		





Talk Tubes - Surface - Wet Pour	
Safer Surface	
Surface	
Yes	
Low	
4	
	\$200 A STATE OF THE STATE OF TH
	Safer Surface Surface Yes Low



Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Carousel - Finding

Finding Title	Carousel - Bearings - Require service	
Asset	Carousel	
Finding Creation Date	14/04/2023 09:30:49	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	





Carousel - Bearings - Require service - Task

	<u> </u>	
Task Title	Service item	



Multiplay Unit - Finding

Finding Title	Item - Cap missing
Asset	Multiplay Unit
Finding Creation Date	14/04/2023 09:18:36
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo

Finding Photos



Item - Cap missing - Task

Task Title	Replace item



Multiplay with Climb Wall - Finding

Finding Title	Item - Bolt missing	
Asset	Multiplay with Climb Wall	1
Finding Creation Date	14/04/2023 09:33:54	2000
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	



Asset Photo



Item - Bolt missing - Task

Task Title	Replace item	



Rocker - Spring Face - Finding

Finding Title	Item - Bolt(s) loose
Asset	Rocker - Spring Face
Finding Creation Date	14/04/2023 09:21:03
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Item - Bolt(s) loose - Task

Task Title	Tighten loose fixtures & fittings




Rocker - Spring Seesaw - Finding

Finding Title	Item - Damaged
Asset	Rocker - Spring Seesaw
Finding Creation Date	14/04/2023 09:28:09
Finding Group	Maintenance
Finding Notes	Main spring has failed - Item was collected by a member of staff and spring was covered
Risk Level	Low





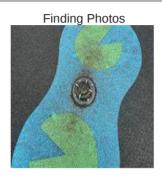

Item - Damaged - Task

Task Title	Make safe pending repair

Rota Play - Finding

Finding Title	Carousel - Bearings - Worn	
Asset	Rota Play	
Finding Creation Date	14/04/2023 09:15:25	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Carousel - Bearings - Worn - Task

Task Title	Repair item

Swing - 1Bay Basket Seat - Findings

Finding Title	Chain - Connectors Worn
Asset	Swing - 1Bay Basket Seat
Finding Creation Date	14/04/2023 09:37:48
Finding Group	Maintenance
Finding Notes	Once worn links are replaced - Raise Seat ground clearance to 400mm
Risk Level	Low







Finding Photos



Chain - Connectors Worn - Task

Task Title	Replace worn parts	



Finding Title	Chain - Bushes Worn	
Asset	Swing - 1Bay Basket Seat	
Finding Creation Date	14/04/2023 09:37:11	A THE
Finding Group	Maintenance	
Finding Notes	Seat Bushes Worn	
Risk Level	Low	



Chain - Bushes Worn - Task

Task Title	Replace bushes

Swing - Small Basket Seat - Finding

Finding Title	Chain - Bushes Worn
Asset	Swing - Small Basket Seat
Finding Creation Date	14/04/2023 09:26:07
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo







Chain - Bushes Worn - Task

Task Title	Replace bushes	



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within Itipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.





Safety Inspection Report

Llanelli Rural Council Tir Einon Play Area Feb 2025

www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with **PSSLive**⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	Γ
Site Name	Tir Einon Play Area	
Actual Date	10/02/2025 11:23:57	/ / /
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	
Inspection Status	Completed	
		10/02/2025



Finding Summary

Tir Einon Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Signage - playground	Item - Not Secure	13/04/2023 20:23:51	Low
A Site - Tireinon Play Area	Surface - Moss	13/04/2023 20:25:44	Low
Swing - 1Bay Toddler Seat	Metal - Paint-work - Not in Good Condition	13/04/2023 20:29:08	Low
Swing - 1Bay Toddler Seat	Item - Moving Parts Greased	13/04/2023 20:29:33	Low
Swing - 1Bay Toddler Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:30:05	Low
Multiplay Unit	Item - Bolt missing	13/04/2023 20:33:20	Low
Multiplay Unit	Item - Corrosion	13/04/2023 20:33:44	Low
Multiplay Unit - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:34:09	Low
Rocker - Spring Face - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:37:47	Low
Rocker - Spring Seesaw - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:40:00	Low
Multiplay Climber - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:42:30	Low
Multiplay Climber	Item - Rusting in places	13/04/2023 20:43:02	Low
Carousel	Item - Bolt missing	13/04/2023 20:46:59	Low
Rota Web Climber - Surface - Wet Pour	Surface - Edges Shrunk	13/04/2023 20:50:44	Low
Free Rider - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	13/04/2023 20:56:50	Low
Free Rider	Item - Rusting in places	13/04/2023 20:57:10	Low
Climb Wall with Ropework	Item - Bolt(s) loose	13/04/2023 21:04:56	Low



Inspection - Tir Einon Play Area - 10/02/2025 11:23:57

Provider	Provider	$ \left(, \wedge \right)$
Site Name	Tir Einon Play Area	
Actual Date	10/02/2025 11:23:57	
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10,02,2020

Site Name	Tir Einon Play Area
Address	Tir Einon Llwynhendy
Postcode	SA149DF
Notes	
Site Owner	Llanelli Rural Council

Tir Einon Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Tireinon Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Carousel
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5







door Play)
• •
-



Asset Name	Climb Wall with Ropework - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Cycle Racks
Asset Type	Cycle Racks
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4
	i.



Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Asset Name	Fitness Area
Asset Type	Outdoor Fitness (Gym Style)
Asset Category	Equipment (Outdoor Fitness)
Manufacturer	Bespoke
EN Compliant	Yes
Risk Level	Low
Risk Score	7





Asset Name	Fitness Area - Surface - Bitmac
Asset Type	Hard Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Free Rider
Asset Type	Agility
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Free Rider - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4
NISK SCOIE	*





Asset Name	Freestyler Unit
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Freestyler Unit - Surface - Grass Mat
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Litter Bin	
Asset Type	Bins	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	
	1	





Asset Name	Multiplay Climber
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Multiplay Climber - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Itiplay uipment (Outdoor Play)
uipment (Outdoor Play)
P (Playgrounds) Ltd
3
V
5





Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Parkour Area
Asset Type	Parkour
Asset Category	Equipment (Parkour)
Manufacturer	HAGS Play Ltd
EN Compliant	Yes
Risk Level	Medium
Risk Score	10
	'



Surface
-







Asset Name	Rocker - Spring Face
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Face - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4

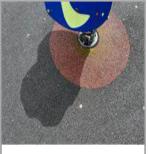

Asset Name	Rocker - Spring Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5

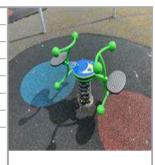



Rocker - Spring Seesaw - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4



Asset Name	Rota Bounce
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rota Bounce - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Rota Web Climber
Asset Type	Climbing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	6



Asset Name	Rota Web Climber - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Seating - Bench	
Asset Type	Seating	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	





eating
acilities
)W



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4

Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	
Trior Goot G	<u> </u>	



Asset Name	Teenage Shelter	
Asset Type	Shelter	
Asset Category	Facilities	_
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	



Play ent (Roller Sports) RSS Ltd
` ' '
2SS td
too Eta





Asset Name	Wheeled Sport - Grind Box - Surface - Bitmac	
Asset Type	Hard Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	



Asset Name	Wheeled Sport - Grind Rail x3
Asset Type	Wheel Play
Asset Category	Equipment (Roller Sports)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Medium
Risk Score	10



Asset Name	Wheeled Sport - Grind Rail x3 - Surface - Bitmac	
Asset Type	Hard Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

A Site - Tireinon Play Area - Finding

Finding Title	Surface - Moss	
Asset	A Site - Tireinon Play Area	
Finding Creation Date	13/04/2023 20:25:44	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	500





Surface - Moss - Task

Task Title	Remove

Carousel - Finding

Finding Title	Item - Bolt missing	
Asset	Carousel	
Finding Creation Date	13/04/2023 20:46:59	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo
		·



Item - Bolt missing - Task

Task Title	Replace item

Climb Wall with Ropework - Finding

Finding Title	Item - Bolt(s) loose
Asset	Climb Wall with Ropework
Finding Creation Date	13/04/2023 21:04:56
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Item - Bolt(s) loose - Task

Task Title	Tighten loose fixtures & fittings



Free Rider - Finding

Finding Title	Item - Rusting in places
Asset	Free Rider
Finding Creation Date	13/04/2023 20:57:10
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo

Finding Photos



Item - Rusting in places - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Free Rider - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Free Rider - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:56:50	100
Finding Group	Maintenance	2
Finding Notes		
Risk Level	Low	
	'	





Task Title	Repair surface



Multiplay Climber - Finding

Finding Title	Item - Rusting in places
Asset	Multiplay Climber
Finding Creation Date	13/04/2023 20:43:02
Finding Group	Maintenance
Finding Notes	
Risk Level	Low
TAISK ECVE	







Item - Rusting in places - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Multiplay Climber - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Multiplay Climber - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:42:30	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	





Task Title	Repair surface



Multiplay Unit - Findings

Finding Title	Item - Corrosion	
Asset	Multiplay Unit	
Finding Creation Date	13/04/2023 20:33:44	
Finding Group	Maintenance	/ / Jut !!
Finding Notes		
Risk Level	Low	y j



Finding Photos



Item - Corrosion - Task

Task Title	Repair item



Finding Title	Item - Bolt missing
Asset	Multiplay Unit
Finding Creation Date	13/04/2023 20:33:20
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo




Item - Bolt missing - Task

Task Title	Replace item



Multiplay Unit - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Multiplay Unit - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:34:09	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	

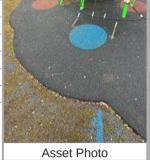




Task Title	Repair surface



Rocker - Spring Face - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings
Asset	Rocker - Spring Face - Surface - Wet Pour
Finding Creation Date	13/04/2023 20:37:47
Finding Group	Maintenance
Finding Notes	
Risk Level	Low

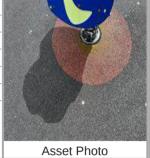





Task Title	Repair surface



Rocker - Spring Seesaw - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Rocker - Spring Seesaw - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:40:00	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	





Task Title	Repair surface



Asset Photo

Rota Web Climber - Surface - Wet Pour - Finding

Finding Title	Surface - Edges Shrunk	
Asset	Rota Web Climber - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:50:44	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		4-7



Surface - Edges Shrunk - Task

Task Title	Repair edges

Signage - playground - Finding

Finding Title	Item - Not Secure
Asset	Signage - playground
Finding Creation Date	13/04/2023 20:23:51
Finding Group	Maintenance
Finding Notes	Signage needs relocated
Risk Level	Low



Item - Not Secure - Task

Task Title	Repair item

Swing - 1Bay Toddler Seat - Findings

Finding Title	Item - Moving Parts Greased	
Asset	Swing - 1Bay Toddler Seat	100
Finding Creation Date	13/04/2023 20:29:33	2
Finding Group	Maintenance	1
Finding Notes		10
Risk Level	Low	100



Asset Photo





Item - Moving Parts Greased - Task

Task Title	Grease moving parts



Finding Title	Metal - Paint-work - Not in Good Condition	1
Asset	Swing - 1Bay Toddler Seat	
Finding Creation Date	13/04/2023 20:29:08	
Finding Group	Maintenance	
Finding Notes		1
Risk Level	Low	1
		1



Asset Photo

Finding Photos



Metal - Paint-work - Not in Good Condition - Task

Task Title De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]	



Swing - 1Bay Toddler Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	A STATE OF THE STA
Asset	Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Finding Creation Date	13/04/2023 20:30:05	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	





Task Title	Repair surface



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within Itipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.






Annual Inspection

Safety Inspection Report

Llanelli Rural Council Trawllm Play Area Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with PSSLive+



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	(
Site Name	Trallwm Play Area	/ // /
Actual Date	10/02/2025 11:03:58	
Inspection Type	Playground-Annual	/ // \ /\
Inspector	Wayne Hock	
Inspection Status	Completed	
		$\bigcup_{\mathcal{U}}$
		10/02/2025



Finding Summary

Trallwm Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Swing - 2Bay Basket/Junior Seat	Chain - Connectors Worn	19/04/2023 11:56:45	Medium
Cable Runway - Surface - Wet Pour	Surface - Poor Drainage	19/04/2023 12:00:09	Medium
Cable Runway	Cable Loose	19/04/2023 12:00:34	Medium
Spinning Bowl - Surface - Wet Pour	Surface - Debris	10/02/2025 11:08:40	Medium
Multiplay Unit	Item - Cap(s) missing	19/04/2023 11:46:54	Low
Swing - 2Bay Basket/Junior Seat	Item - Not Secure	19/04/2023 11:57:04	Low
Cable Runway	Item - Handgrips Missing	10/02/2025 11:05:18	Low
Cable Runway	Cable Worn	10/02/2025 11:06:54	Low



Inspection - Trallwm Play Area - 10/02/2025 11:03:58

Provider	Provider	I = I
Site Name	Trallwm Play Area	
Actual Date	10/02/2025 11:03:58	
Inspection Type	Playground-Annual	(<i>J</i> //
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10,02,2020

Site Name	Trallwm Play Area	
Address	Dylan Llwynhendy	
Postcode	SA149AN	
Notes		
Site Owner	Llanelli Rural Council	

Trallwm Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Trallwm Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4




Asset Name	Cable Runway
Asset Type	Cableway
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	7
NISK OCOIC	





Asset Name	Cable Runway - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Medium	
Risk Score	10	

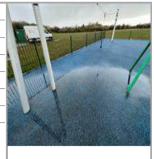

Asset Name	Climber - Rope and Basket Seats
Asset Type	Climbing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Huck Nets (UK) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	7



Asset Name	Climber - Rope and Basket Seats - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Asset Name	Fencing - Bowtop	
Asset Type	Fencing	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Asset Name	Low Rotator
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Low Rotator - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Bee
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Spring Bee - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Rocker - Spring Seesaw
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Spring Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Seating - Bench	
Asset Type	Seating	
Asset Category	Facilities	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	





Asset Name	Signage - playground	
Asset Type	Signage	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	



Asset Name	Spinning Bowl	
Asset Type	Carousel	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Sutcliffe Play Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	



Asset Name	Spinning Bowl - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





Asset Name	Swing - 1Bay Toddler Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Sutcliffe Play Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Swing - 1Bay Toddler Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Swing - 2Bay Basket/Junior Seat
Swing
Equipment (Outdoor Play)
Sutcliffe Play Ltd
Yes
Low
6





Asset Name	Swing - 2Bay Basket/Junior Seat - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	7	
		建设的



Findings and Tasks reported within the Inspection

Cable Runway - Findings

Finding Title	Cable Worn
Asset	Cable Runway
Finding Creation Date	10/02/2025 11:06:54
Finding Group	Maintenance
Finding Notes	
Risk Level	Low







Cable Worn - Task

Task Title	No action required given the risk assessment



Finding Title	Item - Handgrips Missing
Asset	Cable Runway
Finding Creation Date	10/02/2025 11:05:18
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo

Finding Photos




Item - Handgrips Missing - Task

Task Title	Replace



Spinning Bowl - Surface - Wet Pour - Finding

Finding Title	Surface - Debris	-0	
Asset	Spinning Bowl - Surface - Wet Pour		
Finding Creation Date	10/02/2025 11:08:40		
Finding Group	Maintenance		
Finding Notes			
Risk Level	Medium		

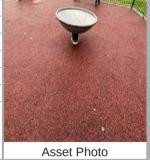





Surface - Debris - Task

Task Title	Remove debris



Previously Reported Findings and Tasks (unresolved at time of Inspection)

Cable Runway - Findings

Cable Loose	
Cable Runway	
19/04/2023 12:00:34	-
Maintenance	
Medium	
	Cable Runway 19/04/2023 12:00:34 Maintenance





Cable Loose - Task

Task Title	Tension Cable



Cable Runway - Surface - Wet Pour - Finding

Finding Title	Surface - Poor Drainage	1
Asset	Cable Runway - Surface - Wet Pour	1
Finding Creation Date	19/04/2023 12:00:09	
Finding Group	Maintenance	À
Finding Notes		100
Risk Level	Medium	1



Asset Photo



Surface - Poor Drainage - Task

Task Title	Consider improved drainage options

Multiplay Unit - Finding

Finding Title	Item - Cap(s) missing	
Asset	Multiplay Unit	
Finding Creation Date	19/04/2023 11:46:54	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Item - Cap(s) missing - Task

Task Title	Replace

Swing - 2Bay Basket/Junior Seat - Findings

Finding Title	Item - Not Secure
Asset	Swing - 2Bay Basket/Junior Seat
Finding Creation Date	19/04/2023 11:57:04
Finding Group	Maintenance
Finding Notes	Ropework around edges coming off
Risk Level	Low



Asset Photo



Item - Not Secure - Task

Task Title	Replace item



Finding Title	Chain - Connectors Worn
Asset	Swing - 2Bay Basket/Junior Seat
Finding Creation Date	19/04/2023 11:56:45
Finding Group	Maintenance
Finding Notes	
Risk Level	Medium



Finding Photos



Chain - Connectors Worn - Task

Task Title	Replace worn parts



Findings and Tasks Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Sevi	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
D.	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
mul nu the tot	E1: The total risk scores included within tipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the national section of the first two numbers are then multiplied total risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or Severity (3).					Severit	У	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with

🔁 **s**ales@dragonplay.co.uk

02922 677190

Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG





Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

mspections inclu		
Provider	Provider	
Site Name	Berwick Play Area	/ /\
Actual Date	10/02/2025 11:34:55	/ // /
Inspection Type	Playground-Annual	/ //~ \
Inspector	Wayne Hock	/ //\
Inspection Status	Completed	
		$\bigcup U$
		10/02/2025



Finding Summary

Berwick Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Entrance - Gate	Gate - Self-Closing - Adjustment	03/04/2023 21:12:32	Low
Swing - 1Bay Basket Seat	Group-Use - Type 1 - Secondary Support	03/04/2023 21:20:49	Low
Multiplay Unit	Metal - Paint-work - Not in Good Condition	03/04/2023 21:23:34	Low
Swing - 1Bay Toddler Seat	Lateral Stability - Suspension Members - Single-Use	03/04/2023 21:28:11	Low
Swing - 1Bay Toddler Seat	Chain - Bushes Worn	03/04/2023 21:29:51	Low
Rota Web Climber	Item - Not Working	03/04/2023 21:31:58	Low
Swing - 2Bay Junior Seat	Minimum Space - Seat to Seat	03/04/2023 21:36:26	Low
Multiplay - Junior - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	03/04/2023 21:42:32	Low
Rocker - spring Elephant	Item - Re-paint	03/04/2023 21:50:47	Low
Rocker - spring Elephant - Surface - Bark	Item - Missing	03/04/2023 21:51:07	Low



Inspection - Berwick Play Area - 10/02/2025 11:34:55

Provider	Provider	$\int \int $
Site Name	Berwick Play Area	/
Actual Date	10/02/2025 11:34:55	
Inspection Type	Playground-Annual	$-(y) \hookrightarrow (y)$
Inspector	Wayne Hock	10/02/2025
Inspection Status	Completed	10/02/2020

Site Name	Berwick Play Area
Address	Berwick Road Bynea
Postcode	SA149SS
Notes	
Site Owner	Llanelli Rural Council

Berwick Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Berwick Park	
Asset Type	Children's Playground	
Asset Category	Site	
Manufacturer		
EN Compliant		
Risk Level	Very Low	
Risk Score	3	



Asset Name	Agility - Balance Trail
Asset Type	Agility
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Agility - Balance Trail - Surface - Grass
Safer Surface
Surface
Yes
Low
4



Asset Name	Carousel
Asset Type	Carousel
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Carousel - Surface - Wet Pour
Safer Surface
Surface
Yes
Low
4
_





Asset Name	Entrance - Gate
Asset Type	Entrance
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	5



Asset Name	Fencing - Chain Link	9
Asset Type	Fencing	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	200
		2



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3





Asset Name	Multiplay - Junior
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Multiplay - Junior - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	-
Risk Level	Low	
Risk Score	5	-
		-



Asset Name	Multiplay Unit
Asset Type	Multiplay
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5
RISK SCOLE	





Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Asset Name	Rocker - Seesaw	\neg
Asset Type	Rocker	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	Record RSS Ltd	
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	_
		_



Asset Name	Rocker - Seesaw - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Rocker - Spring Bike
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	5
	



Asset Name	Rocker - Spring Bike - Surface - Bark
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Rocker - spring Elephant
Rocker
Equipment (Outdoor Play)
Wicksteed Leisure Ltd
Yes
Low
5
-





Asset Name	Rocker - spring Elephant - Surface - Bark
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Rota Web Climber	
Climbing	
Equipment (Outdoor Play)	
Bespoke	
Yes	
Low	
6	
	Climbing Equipment (Outdoor Play) Bespoke Yes Low



Asset Name	Rota Web Climber - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Asset Name	Seating - Mushroom
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3



Asset Name	Seating - Picnic Table
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Very Low
Risk Score	3
	'



Asset Name	Signage - playground	8
Asset Type	Signage	V.
Asset Category	Site	5
Manufacturer		5
EN Compliant		Į.
Risk Level	Very Low	·
Risk Score	3	
	'	â





Asset Name	Swing - 1Bay Basket Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Record RSS Ltd
EN Compliant	No
Risk Level	Low
Risk Score	5



Asset Name	Swing - 1Bay Basket Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4



Swing - 1Bay Toddler Seat
Swing
Equipment (Outdoor Play)
Wicksteed Leisure Ltd
No
Low
5





Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Safer Surface	
Surface	
Yes	
Low	
5	
-	Safer Surface Surface Yes Low



Asset Name	Swing - 2Bay Junior Seat
Asset Type	Swing
Asset Category	Equipment (Outdoor Play)
Manufacturer	Wicksteed Leisure Ltd
EN Compliant	No
Risk Level	Low
Risk Score	5



Asset Name	Swing - 2Bay Junior Seat - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5





Findings reported within the Inspection None Recorded.



Asset Photo

Previously Reported Findings (unresolved at time of Inspection)

Entrance - Gate - Finding

Finding Title	Gate - Self-Closing - Adjustment	
Asset	Entrance - Gate	
Finding Creation Date	03/04/2023 21:12:32	
Finding Group	Maintenance	
Finding Notes		\$4.V
Risk Level	Low	



Gate - Self-Closing - Adjustment - Task

Task Title	Adjust self-closure mechanism



Multiplay - Junior - Surface - Wet Pour - Findings

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Multiplay - Junior - Surface - Wet Pour	
Finding Creation Date	03/04/2023 21:42:32	
Finding Group	Maintenance	1
Finding Notes		
Risk Level	Low	200



Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Multiplay Unit - Finding

Finding Title	Metal - Paint-work - Not in Good Condition
Asset	Multiplay Unit
Finding Creation Date	03/04/2023 21:23:34
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo







Metal - Paint-work - Not in Good Condition - Task


Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Asset Photo

Rocker - spring Elephant - Finding

Finding Title	Item - Re-paint	
Asset	Rocker - spring Elephant	
Finding Creation Date	03/04/2023 21:50:47	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	

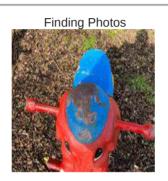

Item - Re-paint - Task

Task Title	Paint and Refurbish



Rocker - spring Elephant - Surface - Bark - Finding

Finding Title	Item - Missing	A STATE OF THE STA
Asset	Rocker - spring Elephant - Surface - Bark	
Finding Creation Date	03/04/2023 21:51:07	5 A.
Finding Group	Maintenance	
Finding Notes	Timber edging missing	
Risk Level	Low	
		Asset Photo



Item - Missing - Task

Task Title	Replace item




Rota Web Climber - Finding

Finding Title	Item - Not Working
Asset	Rota Web Climber
Finding Creation Date	03/04/2023 21:31:58
Finding Group	Maintenance
Finding Notes	Grease bearing
Risk Level	Low



Asset Photo

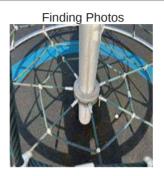

Item - Not Working - Task

Task Title	Repair item



Swing - 1Bay Basket Seat - Finding

Finding Title	Group-Use - Type 1 - Secondary Support	
Asset		
Finding Creation Date		
Finding Group BS EN 1176:2017 Part 2 (Swings - Playground)		
Finding Notes		
Risk Level	Low	



Finding Photos



Group-Use - Type 1 - Secondary Support - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176						



Swing - 1Bay Toddler Seat - Findings

Finding Title	Chain - Bushes Worn					
Asset	Swing - 1Bay Toddler Seat					
Finding Creation Date	Finding Creation Date 03/04/2023 21:29:51					
Finding Group Maintenance						
Finding Notes						
Risk Level	Low					



Asset Photo

Finding Photos



Chain - Bushes Worn - Task

Task Title	Service bushes



Finding Title	Lateral Stability - Suspension Members - Single-Use				
Asset	Swing - 1Bay Toddler Seat				
Finding Creation Date 03/04/2023 21:28:11					
Finding Group BS EN 1176:2017 Part 2 (Swings - Playground)					
Finding Notes					
Risk Level	Low				



Asset Photo



Lateral Stability - Suspension Members - Single-Use - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176					



Swing - 2Bay Junior Seat - Finding

Finding Title	Minimum Space - Seat to Seat	8			
Asset	Swing - 2Bay Junior Seat				
Finding Creation Date 03/04/2023 21:36:26 Finding Group BS EN 1176:2017 Part 2 (Swings - Playground)					
Finding Group	BS EN 1176:2017 Part 2 (Swings - Playground)				
Finding Notes		1			
Risk Level	Low	1			



Asset Photo



Minimum Space - Seat to Seat - Task

Task Title	No action required, based on risk assessment, as asset pre-dates EN 1176					



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
þ	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores		No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality		
can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x			Severity					
	Severity (3).							

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.







Annual Inspection

Safety Inspection Report

Llanelli Rural Council Bryngolau Feb 2025



www.dragonplay.co.uk



sales@dragonplay.co.uk



02922 677190

Working in harmony with **PSSLive**⁺



Inspector Inspection Report

This report shows Findings and Tasks recorded during the Inspection(s) matching the selection criteria set in the Report Wizard. If no Findings or Tasks are shown, none were recorded.

Each Inspection includes a declaration signed by the Inspector stating that no defects were found other than those recorded.

Inspections included in this report

Provider	Provider	1
Site Name	Bryn Golau Play Area	/ Ax
Actual Date	10/02/2025 10:10:00	1 / ///
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	
Inspection Status	Completed	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
		550
		12/02/2025



Finding Summary

Bryn Golau Play Area Findings

Asset	Finding Title	Creation Date	Risk Level
Entrance - Gate	Gate - Buffer(s) required	12/04/2023 19:33:27	Low
Signage - playground	Item - Hard or Sharp Projections	12/04/2023 19:34:32	Low
Seating - Bench	Metal - Excessive Corrosion	12/04/2023 19:36:21	Low
Litter Bin	Metal - Excessive Corrosion	12/04/2023 19:37:33	Low
Rocker - Spring Ark - Surface - Wet Pour	Surface - Edges Shrunk	12/04/2023 19:44:20	Low
Swing - 1Bay Toddler Seat - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	12/04/2023 19:46:28	Low
Swing - 1Bay Toddler Seat	Item - Moving Parts Greased	12/04/2023 19:46:57	Low
Rocker - spring Seesaw - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	12/04/2023 19:49:09	Low
Rota Play - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	12/04/2023 19:51:28	Low
Rota Play	Carousel - Bearings not in good condition	12/04/2023 19:51:49	Low
Multiplay Unit - Surface - Wet Pour	Surface - Perimeter of Surface Shrunk from Edgings	12/04/2023 19:55:00	Low
Multiplay Unit	Item - Bolt missing	12/04/2023 19:55:28	Low
Multiplay Unit	Item - Damaged	12/04/2023 19:56:10	Low



Inspection - Bryn Golau Play Area - 10/02/2025 10:10:00

Provider	Provider	/ /
Site Name	Bryn Golau Play Area	(,A)
Actual Date	10/02/2025 10:10:00	vW/
Inspection Type	Playground-Annual	
Inspector	Wayne Hock	12/02/2025
Inspection Status	Completed	12/02/2020

Site Name	Bryn Golau Play Area
Address	Bryn Golau Dafan
Postcode	SA148PN
Notes	
Site Owner	Llanelli Rural Council

Bryn Golau Play Area Inspected Asset List (see Inspection Notes for exceptions)

Asset Name	A Site - Bryngolau Play Area
Asset Type	Children's Playground
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Entrance - Gate	
Asset Type	Entrance	
Asset Category	Perimeter	
Manufacturer		
EN Compliant		
Risk Level	Low	
Risk Score	4	





Asset Name	Fencing - Bowtop
Asset Type	Fencing
Asset Category	Perimeter
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Asset Name	Litter Bin
Asset Type	Bins
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4



Multiplay Unit
Multiplay
Equipment (Outdoor Play)
SMP (Playgrounds) Ltd
Yes
Low
5





Asset Name	Multiplay Unit - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Rocker - Spring Ark
Asset Type	Rocker
Asset Category	Equipment (Outdoor Play)
Manufacturer	SMP (Playgrounds) Ltd
EN Compliant	Yes
Risk Level	Low
Risk Score	4
Risk Score	4



Asset Name	Rocker - Spring Ark - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	4





_



Asset Name	Rocker - spring Seesaw - Surface - Wet Pour	
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	



Rota Play
Carousel
Equipment (Outdoor Play)
SMP (Playgrounds) Ltd
Yes
Low
5





Asset Name	Rota Play - Surface - Wet Pour
Asset Type	Safer Surface
Asset Category	Surface
Manufacturer	
EN Compliant	Yes
Risk Level	Low
Risk Score	5



Asset Name	Seating - Bench
Asset Type	Seating
Asset Category	Facilities
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	6



Asset Name	Signage - playground
Asset Type	Signage
Asset Category	Site
Manufacturer	
EN Compliant	
Risk Level	Low
Risk Score	4





Asset Name	Swing - 1Bay Toddler Seat	
Asset Type	Swing	
Asset Category	Equipment (Outdoor Play)	
Manufacturer	SMP (Playgrounds) Ltd	THE REAL PROPERTY AND ADDRESS OF THE PERSON NAMED IN COLUMN TWO IN COLUMN TO THE PERSON NAMED IN
EN Compliant	Yes	
Risk Level	Low	
Risk Score	5	



Asset Name	Swing - 1Bay Toddler Seat - Surface - Wet Pour	THE REAL PROPERTY.
Asset Type	Safer Surface	
Asset Category	Surface	
Manufacturer		
EN Compliant	Yes	
Risk Level	Low	
Risk Score	4	
	'	





Findings reported within the Inspection None Recorded.



Previously Reported Findings (unresolved at time of Inspection)

Entrance - Gate - Finding

Finding Title	Gate - Buffer(s) required	
Asset	Entrance - Gate	PLANT COMPANY OF THE PROPERTY
Finding Creation Date	12/04/2023 19:33:27	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo

Gate - Buffer(s) required - Task

Task Title	Fit buffer(s) to gate

Litter Bin - Finding

Finding Title	Metal - Excessive Corrosion	
Asset	Litter Bin	
Finding Creation Date	12/04/2023 19:37:33	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo





Metal - Excessive Corrosion - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]

Multiplay Unit - Findings

Finding Title	Item - Damaged	
Asset	Multiplay Unit	200
Finding Creation Date	12/04/2023 19:56:10	1
Finding Group	Maintenance	
Finding Notes	Plastic damaged on Binoculars	-
Risk Level	Low	
	-	1



Asset Photo

Finding Photos



Item - Damaged - Task

Task Title	Repair item



Finding Title	Item - Bolt missing	
Asset	Multiplay Unit	-
Finding Creation Date	12/04/2023 19:55:28	
Finding Group	Maintenance	-
Finding Notes	Panel bolt missing	The same
Risk Level	Low	
		2



Asset Photo

Finding Photos




Item - Bolt missing - Task

Task Title	Replace item



Multiplay Unit - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Multiplay Unit - Surface - Wet Pour	
Finding Creation Date	12/04/2023 19:55:00	3.0
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	1
		- 10

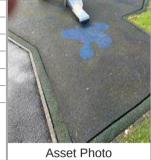



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Rocker - Spring Ark - Surface - Wet Pour - Finding

Finding Title	Surface - Edges Shrunk	Water Commence of the Commence
Asset	Rocker - Spring Ark - Surface - Wet Pour	100
Finding Creation Date	12/04/2023 19:44:20	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	A CONTRACTOR OF THE PARTY OF TH
		Asset Photo



Surface - Edges Shrunk - Task

Task Title	Repair edges



Asset Photo

Rocker - spring Seesaw - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	
Asset	Rocker - spring Seesaw - Surface - Wet Pour	
Finding Creation Date	12/04/2023 19:49:09	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface

Rota Play - Finding

Finding Title	Carousel - Bearings not in good condition	and the second
Asset	Rota Play	
Finding Creation Date	12/04/2023 19:51:49	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Carousel - Bearings not in good condition - Task

Task Title	Repair item

Rota Play - Surface - Wet Pour - Finding

Finding Title Surface - Perimeter of Surface Shrunk from Edgings					
Asset	Rota Play - Surface - Wet Pour				
Finding Creation Date	12/04/2023 19:51:28	1			
Finding Group Maintenance					
Finding Notes		1			
Risk Level	Low	1			
	-	-			





Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Seating - Bench - Finding

Finding Title	Metal - Excessive Corrosion
Asset	Seating - Bench
Finding Creation Date 12/04/2023 19:36:21	
Finding Group	Maintenance
Finding Notes	
Risk Level	Low



Asset Photo



Finding Photos



Metal - Excessive Corrosion - Task

Task Title	De-rust and coat with paint meeting EN 1176 - 4.1.1 [1998]



Signage - playground - Finding

Finding Title	Item - Hard or Sharp Projections	
Asset	Signage - playground	
Finding Creation Date	12/04/2023 19:34:32	August Churchen (A)
Finding Group	Maintenance	Ardal Chwarae i p
Finding Notes		
Risk Level	Low	
		Asset Photo



Item - Hard or Sharp Projections - Task

Task Title	Remove hard, pointed & sharp projections



Swing - 1Bay Toddler Seat - Finding

Finding Title	Item - Moving Parts Greased	
Asset	Swing - 1Bay Toddler Seat	100
Finding Creation Date	12/04/2023 19:46:57	
Finding Group	Maintenance	THE REAL PROPERTY.
Finding Notes		
Risk Level	Low	







Item - Moving Parts Greased - Task

Task Title	Grease moving parts



Swing - 1Bay Toddler Seat - Surface - Wet Pour - Finding

Finding Title	Surface - Perimeter of Surface Shrunk from Edgings	THE PROPERTY OF THE PARTY OF TH
Asset	Swing - 1Bay Toddler Seat - Surface - Wet Pour	
Finding Creation Date	12/04/2023 19:46:28	
Finding Group	Maintenance	
Finding Notes		
Risk Level	Low	
		Asset Photo



Surface - Perimeter of Surface Shrunk from Edgings - Task

Task Title	Repair surface



Findings Reported Outside of the Inspection (unresolved at time of Inspection)

None Recorded.







This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.
BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)



Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to

3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

A full copy of Dragon Play & Sports Ltd. Terms & Conditions is available on request.



					Seve	erity		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
po	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	L (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	L (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
22110				1	2	3	4	5
mul o ni the tol	e 1: The total risk scores included within Itipication factor of the calculated Likeling feach finding. Both Likelihood and Sevumber between 1 - 5 as shown on the ness two numbers are then multiplied to tal risk score that is shown against defeated.	hood erity a natrix gethe cts on	and Severity are given a above and r to give the the report.	No injury likely e.g. demaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Seriaus injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
	n be divided in both directions, i.e. a tot ould be a Likelihood (3) x Severity (4) or					Severit	у	

Note 2: When we inspect, we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.



Working in harmony with

🔽 sales@dragonplay.co.uk



Britannia House, 3 Caerphilly Business Park, Caerphilly CF83 3GG